

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NMSF078106

6. If Indian, Allottee or Tribe Name
EASTERN NAVAJO

SUBMIT IN TRIPLICATE - Other instructions on page 2

7. If Unit or CA/Agreement, Name and/or No.
892000844E

1. Type of Well
 Oil Well Gas Well Other

8. Well Name and No.
GALLEGOS CANYON UNIT 314

2. Name of Operator
BP AMERICA PRODUCTION CO
Contact: TOYA COLVIN
E-Mail: Toya.Colvin@bp.com

9. API Well No.
30-045-24731-00-S1

3a. Address
200 ENERGY COURT
FARMINGTON, NM 87401

3b. Phone No. (include area code)
Ph: 281.366.7148

10. Field and Pool or Exploratory Area
BLANCO PICTURED CLIFFS

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Sec 17 T28N R12W SENW 1580FNL 1560FWL
36.665100 N Lat, 108.138140 W Lon

11. County or Parish, State
SAN JUAN COUNTY, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

82

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

BP requests to P&A the subject well. Please see the attached P&A procedure, wellbore diagram, and the BLM required reclamation plan documents.

In accordance with NMOCD Pit Rule 19.15.17.9 NMAC, BP will use a closed-loop system during operations.

Notify NMOCD 24 hrs
prior to beginning
operations

NMOCD

JUN 11 2018

DISTRICT III

14. I hereby certify that the foregoing is true and correct.
Electronic Submission #414112 verified by the BLM Well Information System
For BP AMERICA PRODUCTION CO. sent to the Farmington
Committed to AFMSS for processing by JACK SAVAGE on 05/22/2018 (18JWS0098SE)

Name (Printed/Typed) TOYA COLVIN Title REGULATORY ANALYST

Signature (Electronic Submission) Date 04/25/2018

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By JACK SAVAGE Title PETROLEUM ENGINEER Date 05/22/2018

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office Farmington

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) **** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ****

NMOCD PV

BP America

Plug And Abandonment Procedure

GCU 314

1580' FNL & 1560' FWL, Section 17, T28N, R12W

San Juan County, NM / API 30-045-24731

1. Hold pre-job safety meeting. Comply with all NMOCD, BLM safety and environmental regulations. Test rig anchors prior to moving in rig if not rigged to base beam.
2. Check casing, tubing, and bradenhead pressures.
3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.
4. ND wellhead and NU BOP. Function test BOP.
5. P/U 4-1/2" bit or casing scraper on 2-3/8" workstring and round trip as deep as possible above top perforation at 1460'.
5. P/U 4-1/2" CR, RIH and set CR at +/- 1410'. Pressure test tubing to 1000 psi. Sting out of CR. Load hole, and pressure test casing to 800 psi. If casing does not test, then spot or tag subsequent plugs as appropriate. POOH w/ tubing.
6. RU wireline and run CBL with 500 psi on casing from CR at 1410' to surface to identify TOC. Adjust plugs as necessary for new TOC. Email log copy to Jack Savage (BLM) at jwsavage@blm.gov and Brandon Powell at Brandon.powell@state.nm.us upon completions of logging operations.

7. Rig up to pump cement down tubing. Pump water to establish rate down tubing.

NOTE: All Plugs Include 100% excess outside casing and 50% Excess inside casing

9. Plug 1 (**Pictured Cliffs perforations and Formation Top 1410'-1352', 6 Sacks Class B Cement**)

Mix 6 sx Class B cement and spot a balanced plug inside casing to cover Pictured Cliffs perforations and formation top.

10. Plug 2 (**Fruitland Formation Top 1053'-903', 12 Sacks Class B Cement**)

Mix 12 sx Class B cement and spot a balanced plug inside casing to cover Fruitland formation top.

11. Plug 3 (**Kirtland, Ojo Alamo Formation Tops and Surface Shoe 271'-surface, 60 Sacks Class B Cement**)

Attempt to pressure test the bradenhead annulus to 300 psi; note the volume to load. If BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 60 sx cement and spot a balanced plug from 271' to surface, circulate good cement out of casing valve. TOH and LD tubing. Shut well in and WOC. If BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing from 271' and the annulus from the squeeze holes to surface. Shut in well and WOC.

12. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and restore location per BLM stipulations.

Wellbore Diagram

Gallegos Canyon Unit 314

API #: 3004524731

San Juan, New Mexico

Surface Casing

7" 17# @ 125 ft

Plug 3

271 feet - Surface

271 feet plug

60 sacks of Class B Cement

Plug 2

1053 feet - 903 feet

150 feet plug

12 sacks of Class B Cement

Plug 1

1410 feet - 1352 feet

58 feet plug

6 sacks of Class B Cement

Formation

Ojo Alamo - 101 feet

Kirtland - 221 feet

Fruitland Coal - 1003 feet

Pictured Cliffs - 1452 feet


Retainer @ 1410 feet

Perforations

1460 feet - 1468 feet

Production Casing

4.5" 10.5# @ 1711 ft

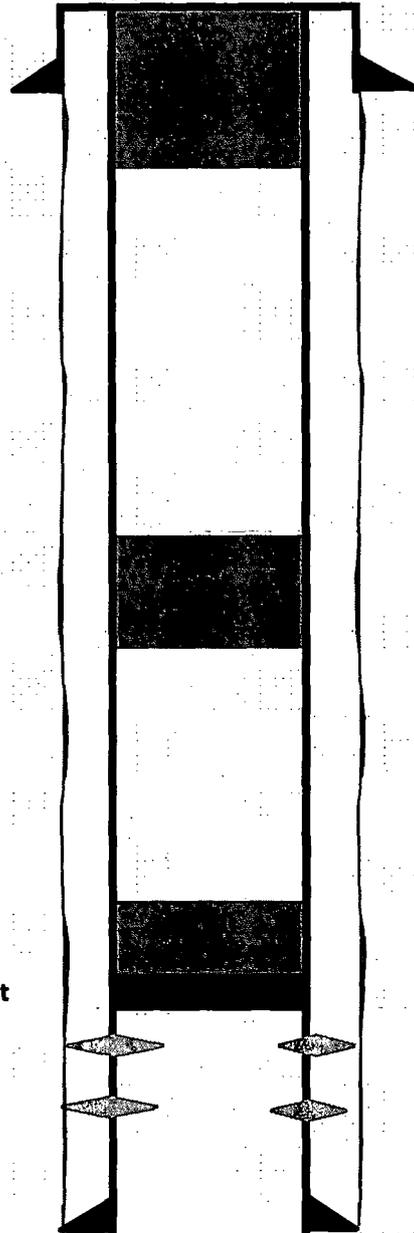

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402

Attachment to notice of
Intention to Abandon:

Re: Permanent Abandonment
Well: Gallegos Canyon Unit 314

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
3. The following modifications to your plugging program are to be made:
 - a) Set plug #2 (1188 - 1088) ft. to cover the Fruitland top. BLM picks top of Fruitland at 1138 ft.
 - b) Set plug #3 (280 - 0) ft. to cover the Kirtland top. BLM picks top of Kirtland at 230 ft.

Operator will run a CBL to verify cement top. Submit the electronic copy of the log for verification to the following addresses: jwsavage@blm.gov Brandon.Powell@state.nm.us

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.