

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Sundry Notices and Reports on Wells

<p>1. Type of Well Gas</p> <p>2. Name of Operator Western Minerals & Oil, LLC</p> <p>3. Address & Phone No. of Operator P. O. Drawer 1228, Farmington, NM 87499</p> <p>Location of Well, Footage, Sec., T, R, M 990' FNL & 790' FWL, Section 4, T-25-N, R-2-W; Unit D</p>	<p>5. Lease Number SF 08473A- 080773A</p> <p>6. If Indian, All. or</p> <p>7. Tribe Name</p> <p>8. Unit Agreement Name</p> <p>9. Well Name & Number Jillson #1</p> <p>10. API Well No. 30-039-06171</p> <p>11. Field and Pool Gavilan PC</p> <p>12. County & State Rio Arriba County, NM</p>
---	--

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission	Type of Action
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input checked="" type="checkbox"/> Other - Well head Repair

13. Describe Proposed or Completed Operations:

Western Minerals repaired the leaking 4.5" casing at the surface per the following:

- 7/18/06 MOL and RU. Pull the 1.25" tubing. ND BOP and dig out the Bradenhead. Set full bore packer at 25' and pulled 27,000#. Filled casing and Bradenhead annulus with water. Checked wellhead for gas, none. Cut off the 8.625" casing below the casing head. Weld on a new 8.625" casing head. Release packer and pick up the 4.5" casing with a spear. Set the 4.5" casing in the new casing head, pulling 40,000# to set the slips. Cut off 15" of the badly corroded 4.5" casing above the new casing head. Weld a new 4.5" bell nipple onto the casing stub. Release the spear and then install a new 4.5" tubing head on the bell nipple. NU BOP and test. Shut in well.
- 7/19/06 Check pressures: casing, 45 PSI and BH, 0 PSI. PU and TIH with 2.375" workstring with bailer to remove fill. Work bailer at 3793'; cleaned out to 3833'. POH with bailer and found set of 1.25" swab tools stuck in flapper. Recovered a rope socket, sinker bar and swab mandrel. These items were apparently lost in the well years ago.
- 7/20/06 TIH with 1.25" tubing and tagged fill 3816'; 9' of the perforations covered. TOH with 1.25" tubing
- 7/21/06 Pick up and TIH with workstring and bailer again. Clean out fill from 3816' to 3841'. Solid tag on bottom with bottom perf at 3825'. TOH to 3000' with bailer.
- 7/24/06 TIH with bailer to check for new fill; tagged at 3841'. TOH with bailer and LD workstring. TIH with 126 joints 1.25" tubing (3804') and land at 3814' KB with SN at 3799' KB. Rig down rig and MOL.

14. I hereby certify that the foregoing is true and correct.

Signed William F. Clark Title Contractor

ACCEPTED FOR RECORD
Date 8/21/06

AUG 28 2006

(This space for Federal or State Office use)

APPROVED BY _____ Title _____

CONDITION OF APPROVAL, if any:

FARMINGTON FIELD OFFICE
BY 211 Date _____

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NMOC