ubmitted in lieu of Form 3160-5 UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT Sundry Notices and Reports on Wells Lease Number NMNM03493 If Indian, All. or 1. Type of Well Tribe Name GAS 7. Unit Agreement Name Huerfano Unit Name of Operator AUG 2003 OIL & GAS COMPANY Well Name & Number 3. Address & Phone No. of Operator Huerfano Unit 111 326-9700 API Well No. PO Box 4289, Farmington, NM 87499 (505) 30-045-05783 4. Location of Well, Footage, Sec., T, R, M 10. Field and Pool 1550'FNL, 1550'FWL, Sec. 20, T-26-N, R-9-W, NMPM Angels Peak Gallup/Basin DK 11. County and State San Juan Co, NM 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Action Type of Submission Change of Plans Notice of Intent Abandonment New Construction Recompletion Plugging Back Non-Routine Fracturing Subsequent Report Water Shut off Casing Repair Conversion to Injection Altering Casing Final Abandonment X Other - commingle Describe Proposed or Completed Operations 06/02/03 MIRU. Run in tbg w/gauge ring. TIH. Gauge ring hung up @5937'. Drop wire cutter bar & POH slickline & cutter leaving 3830' slickline. RD slickline & fin spot rig equip. SDFN. 06/03/03 ND WH, NU BOP's. Pull up tbg to 60,000#, tbg hanger stuck. ND BOP's, remove plate & seals on top of Oct split tbg hanger, NU BOP's. Work tbg, still stuck at WH. Jack tbg, hanger free. SDFN. 06/04/03 ND BOP's P/U on Gallup tbg string to 70,000#, set hand slips under tbg hanger. Remove short side split tbg hgr, NU BOP's, work tbg & release string from j-slot tbg anchor. TOOH short side tbg string. L/D Perf subs, L/D btm jt w/J-latch Assy. TIH tbg, circ w/air on top of tbg anchor @ 5934'. TOOH tbg string. SDFN. 06/05/03 ND BOP's, Pull tbg hgr above WH, remove long string tbg hgr. NU BOP's, work tbg, stuck. RU Wireline. Fish for 3841' of slickline. Made 4 runs. RD Wireline. Work string tbg. No movement. SDFN. 06/06/03 RU Wireline, Run Overshot in tbg, retrieved slickline tools. Run free point, chem cutter above pkr. Cut tbg @ 5990', lost cutter assy. TOOH LD long string. TIH on 2 3/8" short string tbg, tag @ 5986'w/overshot & fell 5'. No Recovery. SDFN. 06/09/03 TIH on 2 3/8" tbg, work overshot over fish @ 5986'. TOOH. Recovered cutter assy @ 5990'. Change rams to 2 7/8", PU DC. TIH w/2 7/8" 6.7# N-80 Eue. Work stg of tbq, stop 30' above top of Gallup perfs @ 5603', Overshot @ 5573'. SDFN. 06/10/03 TIH w/tbg & OS fishing assy. Latch onto fish @ 5990'. Jar on fish w/70,000#. TOOH, recovered 1 piece tbg. MU washover shoe assy. TIH to 5000'. Unload hole w/air. TIH w/washover assy to top of fish, tie back tbg line. Wash over top of fish & top of pkr @ I hereby certify that the foregoing is true and correct. ACCEPTED FOR RECORD Title Regulatory Supervisor (This space for Federal or State Office use) Title APPROVED BY FARMINGTON FIELD, ØFFICE CONDITION OF APPROVAL, if any:
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or
United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdi

5996'. Cut 1' over top of pkr, circ clean. TOOH, LD Assy. SDFN.
06/11/03 TIH w/2 7/8" tbg, tie back tbg line. Latch on tbg, jar on fish. No movement.
TOOH, fish assy recovered. TIH w/ washover assy, tie back tbg line. circ w/air. Cut over stuck pkr, assy @ 5996'w/air to 6004'. Pkr dropped. Pull above perf's. SDFN.
06/12/03 TOOH, L/D washover assy. TIH W/overshot, tie back tbg line, Catch fish. TOOH w/fish, Tie back to double line. Lay down tail pipe below pkr. Shut in. SDFN
06/13/03 Blow Well down. TIH W/DC's & work tbg to top of Gallup perfs. Shut in. SDFN.
06/14/03 Blow well down. PU 7" pkr @ 25.0' w/5500'tbg hung below pkr.ND BOP's & check for gas, OK. ND dual string tbg head, OK. Weld 4" stub onto 7" prod csg. NU new tbg head, NU BOP's, equalize pressure & rel pkr, Pull up & L/D pkr. TIH W/DC's & 2 7/8" tbg, tie back tbg line. Tag @ 6760', break circ w/air, circ hole. Clean, pump sweep, TOOH w/tbg. Shut in. SDFN. 06/16/03 Blow down well, TIH w/ 2 7/8" tbg to 6600', set CIBP @ 6542. M/U mill & TIH on 2 7/8" tbg, tag CIBP @ 6542', Circ w/air. Mill out the CIBP & push plug to 6672'. Circ hole clean. TOOH. Shut well in. SDFN.
06/17/03 TIH W/CIBP & Pkr set @ 6600'. PT CIBP to 600#. Pump 500 gal acid down 2 7/8" tbg w/pkr not set, end of tbg @ 6580'. Displace acid w/38 bbl wtr. TOOH, L/D tbg to 5542'. Set pkr @ 5540', load csg w/170 bbls wtr, PT csg above Gallup Perfs, OK. Rel Pkr. TOOH. Change to 2 3/8" prod tbg. Shut in. SDFN.
06/18/03 TIH W/217 Jts 2 3/8" 4.7# J-55 EUE 8rd tbg. Blow W/air @ 3500', tag CIBP @ 6600', circ. Land tbg w/end of tbg @ 6572'. ND BOP's, NU WH. Pump off Exp check. SDFN.

06/19/03 Blow well down, change valve & nipple. RD. Rig Released.