## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

			<b>尼</b> 尼	CENVED	5.	Lease Number NM 14237
1.	Type of Well		, ,,,		6.	If Indian, All. or
	Gas Storage Observation We	ell	NO.	V <b>23</b> 2007		RCUD NOV 29'07
			Bureau of	Land Management	7.	Unit Agreement Name
	Name of Operator		Famili	igion Field Office		•
	PNM					OIL CONS. DIV.
					8.	DIST. 3 Well Name & Number
	Address & Phone No. of Opera	tor			O.	San Ysidro #1
	Alvarado Square, Albuquerque, NM 87158-2610 (505) 241-4507				9.	API Well No.
		4IVI 07 130-2	.010 (303) 24		<b>3</b> .	30-043-05013
)	cation of Well, Footage, Sec., T,	R, M			10.	Field and Pool
	990' FSL & 990' FWL, Section 20	T_15_N R	2_1_E			Aqua Zarca
	950 1 02 & 550 1 112, 5651011 20	, 1-10-14, 14	<b>Υ- 1-L</b> ,		11.	County & State
						Sandoval County, NM
)	CHECK APPROPRIATE BOX TO	DINDICAT	E NATURE (	OF NOTICE, REP	ORT, OTHER	DATA
	Type of Submission	Type o	of Action			
		V AL	lanmont	Change of F	Plans	
	Notice of Intent	X Aband				
		Recor	mpletion	New Consti		
	Notice of Intent _X Subsequent Report	Recor Pluggi	mpletion ing Back	New Constr	e Fracturing	
		Recor Pluggi Casing	mpletion	New Constr Non-Routin Water Shut	e Fracturing	
	X Subsequent Report	Recor Pluggi Casing	mpletion ing Back g Repair ng Casing	New Constr Non-Routin Water Shut	e Fracturing off	
3	X Subsequent Report Final Abandonment	Recor Pluggi Casing Alterir Other	mpletion ing Back g Repair ng Casing	New Constr Non-Routin Water Shut	e Fracturing off	
3	X Subsequent Report Final Abandonment  Describe Proposed or Complete	Recor Pluggi Casing Alterir Other	mpletion ing Back g Repair ng Casing - ions	New Construction Non-Routin Water Shut Conversion	e Fracturing off	
3	Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the	Recor Pluggi Casing Alterir Other	mpletion ing Back g Repair ng Casing   ions  d well as follo	New Construction Non-Routin Water Shut Conversion	e Fracturing off	
3	X Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme	Recor Pluggi Casing Alterir Other  ted Operation e referenceed int to location	mpletion ing Back g Repair ng Casing    ions  d well as folloon.	New Construction Non-Routin Water Shut Conversion	e Fracturing coff to Injection	uhing flowing water
3	X Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press	Recor Pluggi Casing Alterir Other  ted Operation e referenced int to location ure: tubing,	mpletion ing Back g Repair ng Casing    ions d well as follon. g 200 PSI; ca	New Construction Non-Routine Water Shut Conversion  Dows:	e Fracturing off to Injection ead, 0 PSI. To	
	X Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason,	Recor Pluggi Casing Alterir Other ted Operation e referenced int to location ure: tubing, to pit; flower BLM.	mpletion ing Back g Repair ng Casing   ions  d well as folk on. 200 PSI; ca ed 80 bbls of	New Construction  Non-Routin  Water Shut  Conversion  Dws:  sing and bradenhed water total. No ci	e Fracturing off to Injection ead, 0 PSI. To	casing. Procedure
<u>.</u>	X Subsequent Report  Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix	Recor Pluggi Casing Alterir Other ted Operation e referenced int to location ure: tubing, to pit; flower BLM.	mpletion ing Back g Repair ng Casing   ions  d well as folk on. 200 PSI; ca ed 80 bbls of	New Construction  Non-Routin  Water Shut  Conversion  Dws:  sing and bradenhed water total. No ci	e Fracturing off to Injection ead, 0 PSI. To	casing. Procedure
<u> </u>	X Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.	Recor Pluggi Casing Alterir Other e reference int to location ure: tubing, to pit; flower BLM. x and pump	mpletion ing Back g Repair ng Casing  ions d well as folloon. 200 PSI; caed 80 bbls of	New Construction  Non-Routin  Water Shut  Conversion  Dws:  sing and bradenhed water total. No cite III cement (24 cf)	e Fracturing off to Injection ead, 0 PSI. To rculation out of	casing. Procedure
3	X Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'. 11/06/07: Open up well, no press	Recor Pluggi Casing Alterir Other  ereference int to locatio ure: tubing, to pit; flower BLM. x and pump	mpletion ing Back g Repair ng Casing  ions d well as folloon. 200 PSI; caed 80 bbls of	New Construction  Non-Routin  Water Shut  Conversion  Dws:  sing and bradenhed water total. No cite III cement (24 cf)	e Fracturing off to Injection ead, 0 PSI. To rculation out of	casing. Procedure
3	Subsequent Report Final Abandonment  Describe Proposed or Complet  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'. 11/06/07: Open up well, no press test casing to 800 PSI for 10 min	Recor Pluggi Casing Alterir Other ted Operation to location ure: tubing, to pit; flower BLM. and pumpsure. Tag Tutes	mpletion ing Back g Repair ng Casing  ions d well as folloon. 200 PSI; caed 80 bbls of 18 sxs Type TOC with gau	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhe water total. No cit water total 1989'.	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe  Jet cut tubing	casing. Procedure r from 2222' to at 1987'. Pressure
3.	Subsequent Report Final Abandonment  Describe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty	Recor Pluggi Casing Alterir Other  ted Operation e reference on to location ure: tubing, to pit; flower BLM. x and pump sure. Tag Tutes Type III ceme	mpletion ing Back g Repair ng Casing  ions d well as follo on. 200 PSI; ca ed 80 bbls of 0 18 sxs Type TOC with gau nent (24 cf) tent from 438	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhed water total. No cit at III cement (24 cf) ge ring at 1989'.  from 1987' to 1837' to surface. TOH a	e Fracturing off to Injection ead, 0 PSI. To rculation out of below packe Jet cut tubing off to cover tub and LD tubing	casing. Procedure r from 2222' to at 1987'. Pressure ing stub.
3	Subsequent Report Final Abandonment  Describe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi	Recor Pluggi Casing Alterir Other  ted Operation e reference ont to location ure: tubing, to pit; flower BLM. x and pump sure. Tag T utes Type III ceme t, Cut off we	mpletion ing Back g Repair ng Casing  ions d well as folk on. 200 PSI; ca ed 80 bbls of 0 18 sxs Type TOC with gau nent (24 cf) if ent from 438' rellhead. Cen	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenher water total. No cit at III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH at the control of the control	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and	casing. Procedure  r from 2222' to  at 1987'. Pressure  ing stub.  10' in annulus.
3	Einal Abandonment  Final Abandonment  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs.	Recor Pluggi Casing Alterir Other  ted Operation e reference out to location ure: tubing, to pit; flower BLM. x and pump sure. Tag T utes Type III ceme t, Cut off we	mpletion ing Back g Repair ng Casing  ions d well as folk on. 200 PSI; ca ed 80 bbls of 0 18 sxs Type TOC with gau nent (24 cf) if ent from 438' rellhead. Cen	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenher water total. No cit at III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH at the control of the control	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and	casing. Procedure  r from 2222' to  at 1987'. Pressure  ing stub.  10' in annulus.
3	Subsequent Report Final Abandonment  Describe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi	Recor Pluggi Casing Alterir Other  ted Operation e reference out to location ure: tubing, to pit; flower BLM. x and pump sure. Tag T utes Type III ceme t, Cut off we	mpletion ing Back g Repair ng Casing  ions d well as folk on. 200 PSI; ca ed 80 bbls of 0 18 sxs Type TOC with gau nent (24 cf) if ent from 438' rellhead. Cen	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenher water total. No cit at III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH at the control of the control	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and	casing. Procedure  r from 2222' to  at 1987'. Pressure  ing stub.  10' in annulus.
	Einal Abandonment  Final Abandonment  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs.	Recor Pluggi Casing Alterir Other  ted Operation reference at to location ure: tubing, to pit; flowe BLM. at and pump sure. Tag T utes Type III ceme type III ceme t. Cut off we RD, MOL.	mpletion ing Back g Repair ng Casing  ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) i ent from 438 ellhead. Cen R. Romero,	New Construction  Non-Routing Water Shut Conversion  Dws:  sing and bradenher water total. No cit of elli cement (24 cf) ge ring at 1989'.  from 1987' to 1837' to surface. TOH and the conversion	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and	casing. Procedure  r from 2222' to  at 1987'. Pressure  ing stub.  10' in annulus.
4	Einal Abandonment  Final Abandonment  Describe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs. I location.  I hereby certify that the forego	Recorrect Plugging Casing Alterir Other Med Operation of the Casting of the Casti	mpletion ing Back g Repair ng Casing — ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) ent from 438 ellhead. Cem R. Romero,	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhe water total. No ci e III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH a nent down 15' in 5. BLM, was on locat	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and ion. M. Sikeli	casing. Procedure r from 2222' to at 1987'. Pressure ing stub. 10' in annulus. anos, PNM, was on
4	Einal Abandonment  Poscribe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'. 11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs. I location.	Recorrect Plugging Casing Alterir Other Med Operation of the Casting of the Casti	mpletion ing Back g Repair ng Casing — ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) ent from 438 ellhead. Cem R. Romero,	New Construction  Non-Routing Water Shut Conversion  Dws:  sing and bradenher water total. No cit of elli cement (24 cf) ge ring at 1989'.  from 1987' to 1837' to surface. TOH and the conversion	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and ion. M. Sikeli	casing. Procedure r from 2222' to at 1987'. Pressure ing stub. 10' in annulus. anos, PNM, was on
<b>4</b>	Final Abandonment  Poscribe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', min 2134'. 11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs. I location.  I hereby certify that the foregon william F. Clark	Recor Pluggi Casing Alterir Other ted Operation of the reference of the control o	mpletion ing Back g Repair ng Casing — ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) ent from 438 ellhead. Cem R. Romero,	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhe water total. No ci e III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH a nent down 15' in 5. BLM, was on locat	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and ion. M. Sikeli	casing. Procedure r from 2222' to at 1987'. Pressure ing stub 10' in annulus. anos, PNM, was on
4 Tiç	Final Abandonment  Poscribe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', mix 2134'.  11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs. I location.  I hereby certify that the forego william F. Clark	Recor Pluggi Casing Alterir Other ted Operation of the reference of the control o	mpletion ing Back g Repair ng Casing  ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) tent from 438 ellhead. Cent R. Romero, and correct TitleCont	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhe water total. No ci e III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH a nent down 15' in 5. BLM, was on locat	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and ion. M. Sikeli	casing. Procedure r from 2222' to at 1987'. Pressure ing stub 10' in annulus. anos, PNM, was on
4 TI	Final Abandonment  Poscribe Proposed or Complete  PNM plugged and abandoned the 11/02/07: Road rig and equipme 11/05/07: RU. Check well press Attempt to kill well. Open tubing changed approved by S. Mason, Plug #1 with packer at 2167', min 2134'. 11/06/07: Open up well, no press test casing to 800 PSI for 10 min Plug #1a mix and pump 16 sxs T Plug #2 mix and pump 16 sxs T Plug #2 mix and pump 50 sxs Ty ND BOP. Issue Hot Work Permi Install P&A marker with 20 sxs. I location.  I hereby certify that the foregon william F. Clark	Recorrect Plugging Casing Alterir Other Detection of the Plugging Alterir Other Detection of the Plugging Plugg	mpletion ing Back g Repair ng Casing — ions d well as follo on. 200 PSI; ca ed 80 bbls of o 18 sxs Type TOC with gau nent (24 cf) ent from 438 ellhead. Cem R. Romero,	New Construction Non-Routin Water Shut Conversion  Dws:  sing and bradenhe water total. No ci e III cement (24 cf) ge ring at 1989'.  from 1987' to 1837 to surface. TOH a nent down 15' in 5. BLM, was on locat	e Fracturing off to Injection  ead, 0 PSI. To reculation out of below packe Jet cut tubing off to cover tub and LD tubing off casing and ion. M. Sikeli	casing. Procedure r from 2222' to at 1987'. Pressure ing stub. 10' in annulus. anos, PNM, was on

