

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No 1004-0137
Expires March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NM 23733

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Pride Energy Company

3a. Address
PO Box 701950
Tulsa, OK 74170-1950

3b. Phone No. (include area code)
(918) 524-9200

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
660' FSL and 660' FEL
Unit P Sec 3-20N-3W

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No.
San Isidro No. 3-16

9. API Well No.
300-43-20734

10. Field and Pool or Exploratory Area
Rio Puerco

11. Country or Parish, State
Sandoval Co., NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

Propose to P & A. Procedure attached.

RCVD FEB 15 '08
OIL CONS. DIV.
DIST. 3

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)
Larry Miller

Title Engineer

Signature

Date 01/31/2008

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Original Signed: Stephen Mason

Title

Date

FEB 14 2008

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

(Instructions on page 2)

NMOCD 8

SAN ISIDRO NO. 3-16

PLUGGING PROCEDURE:

1. RUPU. PULL PRODUCTION EQUIPMENT. *Set BP ~ 4300' plug 4300'-4056'*
2. RU WIRELINE. ~~TAG TOP OF CEMENT OVER GIBP @ 1310'. CAP W/ 3917'-3414'~~
ADDITIONAL 40' CMT PLUG. *2600'-2500'*
3. RUN PACKER ON 2-3/8" TUBING TO TOP OF CMT. PLUG AND
CIRCULATE HOLE W/ 9.0 PPG MUD. *112'-902'*
4. ~~PULL PACKER & SET @ 1000'.~~
5. ~~SQUEEZE FRUITDALE COAL PERES @ 1112' 27' W/ 100 SX CMT.~~
~~LEAVE 50' CMT IN CASING.~~
6. SPOT 100' PLUG IN CASING FROM 275'-175'
7. PULL PACKER, SPOTTING 50' PLUG @ SURFACE.
8. CUT OFF CASING 3' BELOW GROUND LEVEL.
9. WELD ON CAP & ERECT STANDARD NEW MEXICO P&A MARKER.
10. CLEAN & RESTORE LOCATION.

**UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
1235 LA PLATA HIGHWAY
FARMINGTON, NEW MEXICO 87401**

Attachment to notice of
Intention to Abandon:

Re: Permanent Abandonment
Well: 3-16 San Isidro

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.

3. The following modifications to your plugging program are to be made:

a) Drill exiting CIBPs and place CIBP ~4300' and cap with cement to 4046' to cover the Gallup.

b) Place a cement plug from 3917' – 3414' to cover the 4 ½" liner top/7" casing shoe.

c) Place a cement plug across the Menefee perms or set a CIBP ~2600' and cap with cement from 2600' – 2500'.

d) Place the Mesaverde plug from 3987' – 3887' inside and outside the 4 ½" casing.

e) Place the Pictured Cliffs/Fruitland/Kirtland/Ojo Alamo plug from 1176' - 902'.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.