Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT | P.O. Box 1980, Hobbs, NM 88240

DISTRICT II P.O. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONS	ERVA	ATION D	IVISION

P.O. Box 2088 Santa Fe, New Mexico 87504-2088

VELL API NO.	
30-031-20199	
5. Indicate Type of Lease	. (=1)
STATE	FEE X

	•		
SUNDRY NOTICES AND REPORTS ON WELLS			
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name		
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			
1. Type of Well:			
OIL WELL GAS OTHER	SANTA FE RAILROAD		
2. Name of Operator	8. Well No.		
BC & D OPERATING, INC.	26		
3. Address of Operator	9. Pool name or Wildcat		
P.O. BOX 1680, HOBBS, NM 88241			
4. Well Location			
Unit Letter N : 660 Feet From The SOUTH Line and 19	980 Feet From The WEST Line		
	NMPM MCKINLEY County		
10. Elevation (Show whether DF, RKB, RT, GR, etc.)			
11. Check Appropriate Box to Indicate Nature of Notice, R	eport, or Other Data		
	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING		

COMMENCE DRILLING OPNS.

OTHER:

CASING TEST AND CEMENT JOB

12. Describe Proposed or Completed Operations (Ctearly state all persinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

PLEASE SEE ATTACHMENT

P & A PROCESS WITNESSED BY MR. HENRY VILLANUEVA WITH NMOCD

CHANGE PLANS

9/21/00

TEMPORARILY ABANDON

PULL OR ALTER CASING

OTHER:



PLUG AND ABANDONMENT

my knowledge and belief.	
PRESIDENT	DATE 12/29/00
	тешеноче нd(505)397—397
	FEB -5 2001
	my knowledge and belief. TITLE PRESIDENT FILE PRESIDENT TITLE PRESIDENT

CONDITIONS OF AFFROVAL, IF ANY:

SANTA FE RAILROAD #26 SEC. 7, T17N, R8W MCKINLEY, NM

- 9/18/2000 MIRU P&A equipment, conduct safety meeting, PU and TIH w/ 2 7/8" tbg., tag TOC @ 1638', load hole w/ fresh water and circulate clean, POOH w/ tbg., prepare to POOH w/ csg., secure well, SDFN.
- 9/20/2000 Crew to location, MIRU wireline truck, conduct safety meeting, TIH to free point and cut csg. @ 957', could not pull csg., cut csg. @ 525', rig dn wireline truck, TIH w/ tbg to 1037', circulate hole clean, mix and pump 116 sxs class "B" cmt (136.88 cu. ft.) Good circulation throughout job, POOH w/ tbg., secure well, SI, WOC.
- Orew to location, conduct safety meeting, TIH w/ 2 7/8" tbg., tag TOC @ 293', circulate hole clean, POOH w/ 2 7/8" tbg. to 222' (8 5/8" @ 140') mix and pump 109 sxs class "B" cmt. (129 cu. ft.), w/ good slurry to pit, POOH w/ tbg., hole stable, top off 8 5/8" csg., rig dn. move off, install P&A marker, clean location. Final report.