

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 41 R1424.

2. LEASE DESIGNATION AND SERIAL NO.

515 NM 28692

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Harvard Federal

9. WELL NO. #1

10. FIELD AND POOL, OR WILDCAT

So. Blanco P.C.

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec. 2 T23N, R1W

12. COUNTY OR PARISH 13. STATE

Rio Arriba

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

James K. Folk

3. ADDRESS OF OPERATOR

Route 1 Box 41 Aztec, New Mexico, 87410

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1850' FNL & 1850' FEL

14. PERMIT NO.

30-039-21808

15. ELEVATIONS (Show whether OF, RT, GR, etc.)

7267 GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of start of proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and pertinent to this work.)*

5-21-79 Move on rig and rigged up.

5-22 to 24 Drill out cement to 582'

5-25-79 Ran 19 jts. 5 1/2" csg. (14# J 55) 581' set @ 579' KB. Cmt w/50 sks neat Plug down 5:30 P.M. 5-25-79.

5-28-79 Pressure test csg to 400# held O.K. Cleaned out to 552'.

5-29-79 Displaced hole w/16 bbls. 15% HCL. Ran corr logs-Perf 2 shots p/ft 502-10, 526-34. Pumped acid down at 50#, rate 3 bbls/min. S.I. 175#

5-31-79 Swab and rec approx 12 bbls. fluid, small show of gas.

6-6-79 Ran 5 1/2" packer, set @ 480' pumped in 15 bbls 15% HCL @ 200#.

6-7-79 Swab back thru tbgs. Rec approx. 8 bbls mud and acid water.

6-8-79 Swab hole dry. Total rec approx 9 bbls. Ran 25 jts. 1" tbgs. Set @ 522'. Cleaned location, back filled pits, rig down.

6-9-79 Rigged up and set air compressor. Will blow well down periodically and test for gas.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Operator

DATE 6-19-79

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

