

DEPARTMENT OF THE INTERIOR

(Copy instructions on reverse side)

Budget Bureau No. 42-21421

GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

5. LEASE DENOMINATION AND ABBREVIATION NO.

NM 8901

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

El Norte

9. WELL NO.

#2

10. FIELD AND POOL, OR WILDCAT

Snake Eyes

11. SEC., T., R., M., OR S.E. AND SURVEY OR AREA

Sec. 17-21N-8W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

OIL WELL ☐ GAS WELL ☒ OTHER

Abandonment

1. NAME OF OPERATOR

Davis Oil Company

2. ADDRESS OF OPERATOR

1230 Denver Club Bldg., - Denver, Colorado 80202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660 FSL 660 FWL Sec. 17-T21N-R8W

14. PERMIT NO.

15. ELEVATIONS (Show whether top, bottom, etc.)

6583 Gr.

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NATURE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

FULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT ON:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

El Norte No. 2 was plugged and abandoned on October 5, 1974 as follows:

1. 50 sx cement plug was placed across the Dakota perfs (4614-15; 4626-30). Tubing was pulled above the cement and surface squeezed leaving at least 50' of cement above top perforation.
2. 3,124' of casing was recovered. 50 sx plug was placed at the stub leaving 50' cement in the stub and at least 50' cement above the stub.
3. 95 sx cement plug was placed from 450' across the Pictured Cliffs formation.
4. Dry hole marker was installed in top of surface pipe with 5 sx cement.
5. Location was cleaned and leveled and as time and weather permits, Drake Well Service will complete the restoration.

18. I hereby certify that the foregoing is true and correct

SIGNED

R. S. McDonald

TITLE

Production Manager

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

U. S. GEOLOGICAL SURVEY

FARMINGTON, N. M.

DATE

12/23/74

*See Instructions on Reverse Side



1944

1945

1946

