

BLM
Robert Ramirez

Form 9-331
(May 1983)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Order: 1. Original, 2. To
Bureau, 3. To State)

Form approved
Bureau Order No. 40-81324
3. LEASE DESIGNATION AND FIELD NO.

SF-078534

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different formation.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

BCO, Inc.

3. ADDRESS OF OPERATOR

135 Grant Ave. Santa Fe, New Mexico 87501

4. LOCATION OF WELL (Report location clearly and in accordance with any State or Federal survey.
See also space 17 below.)
At surface

590' FNL 1650' FEL SEC 31 T24N R6W

RECEIVED

MAY 26 1983

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DT, AT, or PL)

GR 6734

6. IF INDIAN, ALLOTTEE OR TRUST NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Bobby B

9. WELL NO.

2

10. FIELD AND TOWN, OR WILDCAT

Escrito Gallup

11. SEC., T., R., OR BLK. AND
SURVEY OR AREA

31 T24N R6W NMPM

12. COUNTY OR PARISH 13. STATE

Rio Arriba NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PELL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and points pertinent to this work.)

5/17/83 Set BP at 5302'. Determined well has a hole between 3591' and 3622'.
Advised John Keller with BLM that we intended to repair same with cement
on 5/18/83 at 8:00 A.M.

5/18/83 Set packer at 3191'. Repaired hole in casing with 500 sacks Class H,
2% CaCl, 5/10% CFR-2 cement. Final squeeze pressure 1175 pounds. Mud
and water circulated out bradenhead during most of the cement job.

5/20/83 to 5/23/83 Drilled cement. Pressure tested at 90 pounds and held.

Displaced water in hole with KCL water. Removed BP.

5/24/83 to 5/25/83 Swabbed well and placed back in production.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE President

DATE 5/25/83

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

MAY 27 1983

NMOCC