

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. <i>Jicarilla Contract 68</i>																	
2. NAME OF OPERATOR Texaco, Inc. (505)325-4397		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Jicarilla Apache																	
3. ADDRESS OF OPERATOR 3300 N. Butler, Farmington, NM 87401		7. UNIT AGREEMENT NAME																	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FNL and 1980' FEL		8. FARM OR LEASE NAME Jicarilla "B"																	
14. PERMIT NO.		9. WELL NO. #13																	
15. ELEVATIONS (Show whether on RT. or L. side) 6743' DF		10. FIELD AND POOL, OR WILDCAT Basin Fruitland Coal																	
16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data <table border="1"><tr><td>TEST WATER SHUT-OFF</td><td>PULL OR ALTER CASING</td><td>WATER SHUT-OFF</td><td>REPAIRING WELL</td></tr><tr><td>FRACTURE TREAT</td><td>MULTIPLE COMPLETE</td><td>FRACTURE TREATMENT</td><td>ALTERING CASING</td></tr><tr><td>SHOOT OR ACIDIZE</td><td>ABANDON*</td><td>SHOOTING OR ACIDIZING</td><td>ABANDONMENT*</td></tr><tr><td>REPAIR WELL</td><td>CHANGE PLANS</td><td>(Other)</td><td></td></tr></table> Recomplete		TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF	REPAIRING WELL	FRACTURE TREAT	MULTIPLE COMPLETE	FRACTURE TREATMENT	ALTERING CASING	SHOOT OR ACIDIZE	ABANDON*	SHOOTING OR ACIDIZING	ABANDONMENT*	REPAIR WELL	CHANGE PLANS	(Other)		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 32, T25N-R5W	
TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF	REPAIRING WELL																
FRACTURE TREAT	MULTIPLE COMPLETE	FRACTURE TREATMENT	ALTERING CASING																
SHOOT OR ACIDIZE	ABANDON*	SHOOTING OR ACIDIZING	ABANDONMENT*																
REPAIR WELL	CHANGE PLANS	(Other)																	
17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) Oil Con. Div. DIST. 3		12. COUNTY OR PARISH 13. STATE Rio Arriba NM																	

Texaco Producing Inc. proposes the following workover to recomplate the Basin Fruitland formation. The following procedure will be followed:

1. MIRUSU. Install BOP. POH w/ tubing.
2. RIH w/ 5-1/2" cement retainer on 2-3/8" workstring.
3. Set retainer @ 2680' and establish injection rate into Picture Cliffs perforations 2690' - 2698'.
4. Squeeze perms w/ 100 sks cement.
5. Pull up and spot 2 sks on retainer. Pull up and reverse out excess cement. POH. WOC.
6. Test casing to 1000 PSIA.
7. RU wireline and run GR/CNL from PBTD.
8. Perforate Basin Fruitland Coal 2-JSPF 2580' - 2666'. Perfs need to be revised after logging.
9. Run 3-1/2" frac tubing w/ packer set 50' above perms.
10. Frac w/ 65,000 gal. foam and 70,000 sand.
11. Flow/swab back load.
12. Pull treating equipment. Run production string and test.

18. I hereby certify that the foregoing is true and correct

SIGNED

Alan T. Kleier

TITLE **Area Manager**

ACCEPTED FOR RECORD

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

SEP 10 1990

FARMINGTON RESOURCE AREA

BLM - FARMINGTON (5), RSL, AAK, JICARILLA TRIBE, MLK, MAG

*See Instructions on Reverse Side