Form 31EQ-5 (June 1990)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED Budget Bureau No. 1004-0135

Expires: March 31, 1993

5. Lease Designation and Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  Use "APPLICATION FOR PERMIT - " for such proposals		JICARILLA CONTRACT 148  6. If Indian, Allottee or Tribe Name	
		7. If Unit or CA, Agreement D	esignation
1. Type of Well Oil Gas Wall Other		8. Well Name and No.  JICARILLA CONT 1	48 #40
Name of Operator  AMOCO PRODUCTION COMPANY  AMOCO PRODUCTION COMPANY  WAYNE BRANAM, RM 1220		9. API Well No.	
3. Address and Telephone No.		3003923697	
P.O. Box 800, Denver, Colorado 80201	_	10. Field and Pool, or Explorate	ory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		WEST LINDRETH C	SALLUP DAKOTA
930 FNL 730 FEL Sec.	13 T 25N R 5W	11. County or Parish, State	NEW MEXICO
CHECK APPROPRIATE BOX(s) TO	INDICATE NATURE OF NOTICE RE	PORT, OR OTHER D	4TA
TYPE OF SUBMISSION	TYPE OF ACTION		
TARE OF SORIMISSION			
Notice of Intent  Subsequent Report	Abandonment Recompletion Plugging Back Casing Repair Altering Casing	Change of Plans  New Construction  Non-Routine Fracturing  Water Shut-Off  Conversion to Injection	
Final Abandonment Notice	Other(Note: R	Dispose Water eport results of multiple completion letion Report and Log form.	on Well Completion or
subsurface locations and measured and true vertical depths for a AMOCO PROPOSES TO REPAIR THIS WELL PE			
14. I hereby certify that the foregoing is true and correct  Signed	Title BUSINESS A	ANALYST Date	12-21-1994
Approved by Conditions of approval, if any:	Fol Chief, Lands and M	ineral Resources Date	JAN 2 4 1995

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, ficticious, or fraudulent statements or

## JICARILLA CONTRACT 148 - 40 SEC 13 - T25N - R5W RIO ARRIBA COUNTY, NM REPAIR WELL PROCEDURE

- 1. TOOH with the 2-7/8" production tbg.
- 2. TIH with bit and scraper for 5-1/2" csg to 8000'. .
- 3. Wireline set a CIBP at 7950'.
- 4. Cap the CIBP with 10' of sand/barite mixture. Bring the mixture up to 7940'. The mixture should be 33% barite and 67% 20/40 sand.
- 5. TIH with muleshoe, SN, and 2-3/8" tbg and land intake at 7850'. Check with Ralph Montoya before running the tbg in the well. Ralph may want to run 2-1/16" tbg rather than the 2-3/8" tbg.
- 6. Swab the well in and RTP.



