UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

					5.	Lease Number
			ر ماران		, ·	Jic Contract 416
Type of Well				A.	6.	If Indian, All. o
GAS				2000		Tribe Name Jicarilla Apache
:			N		7.	Unit Agreement Na
Name of Oper	$NGTON \\ RCES _ { m OIL}$					
		& GAS COMPANY		10 mm 20 mm	8.	Well Name & Number Medio Canyon #7
Address & Ph	one No. of Operato, Farmington, NM	87499 (505)	326-9700		9.	
	Well, Footage, Se	ec. T. R. M			10.	Field and Pool
2310'FNL, 66	50'FWL, Sec.35, T	-24-N, R-4-W,	NMPM		11.	Lindrith Gal/DK County and State Rio Arriba Co, N
CHECK YDDD	OPRIATE BOX TO IN	DICATE NATURE	OF NOTIC	E, REPORT	, OTHER	DATA
Type of Sub	mission		туре ог А	CLION		
Not:	ice of Intent	Abandon	ment	Chang	ge of Pl	ans
	100 02 2222	Recompl	etion	New 0	Construc	tion
y Cub	sequent Report	Pluggin	g Back	Non-I	Routine	Fracturing
X Sub	sequenc Report	Casing	Repair	Water	c Shut o	off
m.'	- 1 Thendonment	Alterin	d Casing	Conve	ersion t	o Injection
Fin	al Abandonment	Alterin	g Casing	Conve	ersion t	o Injection
Fin	al Abandonment	Alterin	g Casing	Conve	ersion t	co Injection
		X Other -	ng Casing - Pump ins	Conve	ersion t	co Injection
	al Abandonment Proposed or Comp	_X_ Other -	ng Casing - Pump ins	Conve	ersion t	co Injection
. Describe	Proposed or Comp	X Other -	ng Casing - Pump ins	Convestallation	ersion t	
Describe	Proposed or Comp	X_ Other -	ng Casing - Pump ins	Convestallation	ersion t	3 bbl 2% KCl wtr.
. Describe	Proposed or Comp	X_ Other -	ng Casing - Pump ins	Convestallation	ersion t	3 bbl 2% KCl wtr.
Describe	MIRU. TOOH w/12 TOOH w/rods & pu pT tbg to 500	x Other - cleted Operation rods. SDON. nmp. Drop star psi, failed.	eg Casing - Pump ins ions - Inding value - Tighten of	Convestallation ve. Load connection	tbg w/2	3 bbl 2% KCl wtr. tbg to 500 psi/15
Describe	MIRU. TOOH w/12 TOOH w/rods & pu pT tbg to 500	x Other - cleted Operation rods. SDON. nmp. Drop star psi, failed.	eg Casing - Pump ins ions - Inding value - Tighten of	Convestallation ve. Load connection	tbg w/2	3 bbl 2% KCl wtr. tbg to 500 psi/15
Describe	MIRU. TOOH w/12 TOOH w/rods & pu pT tbg to 500 OK. ND WH. NU TIH w/mill to 72	x Other - cleted Operation rods. SDON. nmp. Drop star psi, failed.	eg Casing - Pump ins ions - Inding value - Tighten of	Convestallation ve. Load connection	tbg w/2	3 bbl 2% KCl wtr. tbg to 500 psi/15
Describe	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 72 TOOH. SDON.	X_ Other - Noteted Operation rods. SDON. Imp. Drop star psi, failed. BOP. TOOH w/t 286'. Establish	ng Casing - Pump ins - Dons -	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd.	3 bbl 2% KCl wtr. tbg to 500 psi/15
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 72	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X Other - Note of the control of th	ons Idons Inding value Tighten of the circ.	Convestallation ve. Load connection or weeken CO to PBT	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00 4-19-00	MIRU. TOOH w/12 TOOH w/rods & pu pt tbg to 500 OK. ND WH. NU TIH w/mill to 72 TOOH. SDON. TIH w/236 jts 2 SDON. TIH w/195 ¾" rod	X Other - Noteted Operation rods. SDON. Imp. Drop star psi, failed. BOP. TOOH w/t 286'. Establis 3/8" 4.7# J- s, 98 7/8" ro	ng Casing Pump ins Lons Inding valuable Tighten of the circ. 55 EUE the ds & pump	Convestallation ve. Load connection or weeken CO to PBT g, landed	tbg w/2 ns. PT d. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
Describe 4-13-00 4-14-00 4-17-00 4-18-00 4-19-00	Proposed or Comp MIRU. TOOH w/12 TOOH w/rods & pu PT tbg to 500 OK. ND WH. NU TIH w/mill to 73 TOOH. SDON. TIH w/236 jts 2	X_ Other - X_ Other -	eg Casing Pump ins Lons Inding valuable Tighten of the circ. 55 EUE the ds & pump	Convestallation ve. Load connection or weeken CO to PBT g, landed . RD. Ric	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea '. ND BOP. NU WH.
Describe 4-13-00 4-14-00 4-17-00 4-18-00 4-19-00	MIRU. TOOH w/12 TOOH w/rods & pu pt tbg to 500 OK. ND WH. NU TIH w/mill to 72 TOOH. SDON. TIH w/236 jts 2 SDON. TIH w/195 ¾" rod	X_ Other - X_ Other -	eg Casing Pump ins Lons Inding valuable Tighten of the circ. 55 EUE the ds & pump	Convestallation ve. Load connection or weeken CO to PBT g, landed . RD. Ric	tbg w/2 ns. PT dd. D @ 744	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea
. Describe 4-13-00 4-14-00 4-17-00 4-18-00 4-19-00	MIRU. TOOH w/12 TOOH w/rods & pu pt tbg to 500 OK. ND WH. NU TIH w/mill to 72 TOOH. SDON. TIH w/236 jts 2 SDON. TIH w/195 ¾" rod	X Other - Noleted Operation rods. SDON. Imp. Drop star psi, failed. BOP. TOOH w/t 286'. Establis 3/8" 4.7# J- s, 98 7/8" ro	egulatory	ve. Load connection weeken CO to PBT g, landed . RD. Rig	tbg w/2 ns. PT d. D @ 744 l @ 7361 g releas	3 bbl 2% KCl wtr. tbg to 500 psi/15 3'. Circ hole clea '. ND BOP. NU WH.