Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

						/
ਜ਼	-	Of	11	Æ.	[]	
12	2		11	/	$\cap i$	

FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

5. Lease Designation and Serial No.

				NM-087657
SUNDRY NOTICES AND REPORTS ON	WELLS	31.15 g/7	DU OLIM	6. If Indian, Allottee or Tribe Name
MANUL MOLIOFO VIEW II THE COLLEGE COLL		4144		,

0110	MIT IN TRIPLICATE	7. If Unit or CA, Agreement Designation
	SMIT: IN TRIPLICATE	ESCRITO GALLUP
pe of Well Oil Well Well Other	<u>:</u>	8. Well Name and No.
ne of Operator		FSCRITO GALLUP. U.
CO, INC.		3004513017
35 GRANT. SANTA FE.	NM 87501 (505) 983-1228	10. Field and Pool, or Exploratory Area
cation of Well (Footage, Sec., T., R., M., or Su	rvey Description)	FSCRITO GALLUP
355' FNL & 410' FEL, NE/4 OF THE NE/4 (A)		SAN JUAN, NM, NM
AA WAAN MAN	•	
CHECK APPROPRIATE	BOX(s) TO INDICATE NATURE OF NO	TICE, REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYP	E OF ACTION
Notice of Intent	Abandonment	Change of Plans
	Recompletion	New Construction Non-Routine Practuring
Subsequent Report	Plugging Back	☐ Wester Shut-Off
	Casing Repair Altering Casing	Conversion to Injection
Final Abandonment Notice	Other	Dispose Water
		(Note: Report results of multiple completion on We Completion or Recompletion Report and Log form
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM.	50 FING WAS GIVEN IN
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTE PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM 4 THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED " 4297'-4329'. THE RBP WAS 5	TING WAS GIVEN IN TO ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM A THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT F NOTIFIED THE WELL WOL	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED 4297'-4329'. THE RBP WAS ST 3950'. THE FAILURE WAS ST 2% CALCIUM CHLORIDE. THE ERE WAS A VOID IN THE CEMENT ENT WAS DRILLED FROM 4332' REPAIR THE CASING FAILURE, ULD BE PLUGGED AND ABANDONS	TING WAS GIVEN IN TO ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS ED.
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM 4 THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT F NOTIFIED THE WELL WOL	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED 4297'-4329'. THE RBP WAS ST 1 3950'. THE FAILURE WAS ST 2% CALCIUM CHLORIDE. THE ERE WAS A VOID IN THE CEMENT ENT WAS DRILLED FROM 4332' REPAIR THE CASING FAILURE, ULD BE PLUGGED AND ABANDONS RTON JOB LOG	TING WAS GIVEN IN TO ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS ED.
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM 4 THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT F NOTIFIED THE WELL WOL PBTD: 5951' ATTACHMENTS: HALLIBUE L hereby certify that the forespire is true last con- Signed	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED 4297'-4329'. THE RBP WAS S T 3950'. THE FAILURE WAS S 2% CALCIUM CHLORIDE. THE ERE WAS A VOID IN THE CEMENT ENT WAS DRILLED FROM 4332' REPAIR THE CASING FAILURE, ULD BE PLUGGED AND ABANDONE	TING WAS GIVEN IN TO ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS ED.
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM 4 THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT F NOTIFIED THE WELL WOL PBTD: 5951' ATTACHMENTS: HALLIBUE Thereby certify that the forepoint is true and con-	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED 4297'-4329'. THE RBP WAS S 1 3950'. THE FAILURE WAS S 2% CALCIUM CHLORIDE. THE ERE WAS A VOID IN THE CEMENT ENT WAS DRILLED FROM 4332' REPAIR THE CASING FAILURE, ULD BE PLUGGED AND ABANDONE RTON JOB LOG Tible SENIOR FIELD	FINGINEER O ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS ED.
CERTIFIED RETURN RECE ON JUNE 9, 1994, NOTI PERSON TO KEVIN SCHNE A RETRIEVABLE BRIDGE CASING FAILURE FROM 4 THE PACKER WAS SET A SX OF CLASS "B" WITH FROM 3982'-4313'. THE 4332', SCATTERED CEME THE SQUEEZE DID NOT F NOTIFIED THE WELL WOL PBTD: 5951' ATTACHMENTS: HALLIBUE L hereby certify that the forespire is true last con- Signed	EIPT REQUESTED: P626 361 85 IFICATION OF SQUEEZE CEMENT EIDER WITH THE BLM. PLUG AND PACKER WAS USED 4297'-4329'. THE RBP WAS S T 3950'. THE FAILURE WAS S 2% CALCIUM CHLORIDE. THE ERE WAS A VOID IN THE CEMENT ENT WAS DRILLED FROM 4332' REPAIR THE CASING FAILURE, ULD BE PLUGGED AND ABANDONE RTON JOB LOG SENIOR FIELD	FING WAS GIVEN IN TO ISOLATE THE SET AT 5151' AND SQUEEZED WITH 250 CEMENT WAS DRILLED NT FROM 4313' TO TO 4550'. THE BLM WAS ED. ENGINEER Date O6/17/94

*See Instruction on Reverse Side

~

