Form 3160-5 Tovember 1983) Formerly 9-331)

16

UNITED STATES DEPARTMENT OF THE INTERIOR

ES SUBMIT IN TRIPLICATES
Other instructions on in

Budget Bureau No. 1004-0135 Expires August 31, 1985

5. LEASE DESIGNATION AND SECIAL NO.
NOO-C-14-20-3585

ARTIVICIAL	Or	THE HATERION TELEVISION	
HREALL OF L	AND	MANAGEMENT	

	BUREA			
	(The man this form for Dropos	CES AND REP	PORTS ON WELLS en or plug back to a different reservoir. "for such proposals.)	6. IF INDIAN, ALLOTTEE OR TEILE NAME Navajo
1.	OIL GAB X OTHER		87 MM - 9 PM 12: 14	7. UNIT AGREEMENT NAME
2.	NAME OF OPERATOR		FARMING 1011 0-000	8: FARM OR LEASE NAME
و	E. Coleman Oil & Gas, I	nc.	FARMINGTON RESOURCE AREA FARMINGTON, NEW MEXICO	Dry Creek
3.	ADDRESS OF OPERATOR		THE VICO	9. WELL NO.
	Drawer 3337, Farming			2
4.	LOCATION OF WELL (Report location closes also space 17 below.) At surface	early and in accordance	e with any State requirements.*	10. FIELD AND POOL, OR WILDCAT Bisti Lower Gallup
				11. SEC., T., E., M., OR BLK. AND SURVEY OR AREA
	330 FNL and 99 FWL			Sec. 5, T24N, R10W
14	PERMIT NO.	15. ELEVATIONS (Show	whether DF, RT, GR, etc.)	12. COUNTY OR PARISH 13. ETATE
		6827 GR		San Juan N.M.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT EXPORT OF:			
TEST WATER SHUT-OFF PRACTURE TREAT SHOOT OR ACIDIZE		PCLL OR ALTER CASING MULTIPLE COMPLETE ABANDON*	X	WATER SHUT-OFF FRACTURE TREATMENT SHOOTING OR ACIDIZING	REPAIRING WELL ALTERING CASING ABANDONMENT*	
REPAIR WELL (Other)		CHANGE PLANS		(Other) (Note: Report results of mu Completion or Recompletion I	Oltiple completion on Well Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting a proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and rober per nent to this work.)

- 1. Set bridge plug at 5192! and spot 25 sks cement on top
- 2. Roll hole with 9.2 # mud
- 3. Perforate Cliffhouse at 3110' and cement inside and outside $4\frac{1}{2}$ " casing from 3110 to 3010, 25 sks
- 4. Chacra Perf. 2406' set 25 sk plug inside and out of $4\frac{1}{2}$ " casing 2406' to 2306'
- 5. Picutred Cliffs and Fruitland perf. 1685' set 25 sk plug inside and out of 4½" casing 1685' to 1550'
- 6. Ojo Alamo perf. 924' set 45 sk plug inside and out of 4½" casing 924' to 702'
- 7. Surface perf. 261' set 25 sk plug inside and outside 4½" casing 261' to
- 8. Top plug 50' 0 cement inside and outside of 41" rading, 10 sks. 3
- 9. Erect dry hole marker
- 10. Clean location and seed to specifications

W. M. Gallaway	11-9-87
(W : pro for Pederal or State office us:)	(Pam
A STATE THE PROVING BY AKY:	for the fall

in h

See Instructions on to a restale