

dick harnly
consulting petroleum geologist
1932 eastlawn ave, durango colorado, 81301, 303-247-1518

of water loss and the occurrence of bridging problems but the facts do present the question "would there have been these problems if a low water loss characteristic had been incorporated in the mud system prior to drilling out from under the surface casing". A low water loss, 8 cc or less, may or may not preclude the occurrence of these problems but a couple of hours "wasted" by mixing mud with a low water loss before "drilling out" weighed against the possibility of several days attempting to get logs to go should certainly be considered.