



August 20, 1974

Oil Conservation Commission
1000 Rio Brazos
Aztec, New Mexico 87410

Attn: Mr. A.R. Kendrick

Gentlemen:

This is to inform you that work has been completed on the Jicarilla A-1 Dakota Mesa Verde gas well to repair a packer leakage problem.

The packer leakage test was run August 10 through August 17, and the forms will be filed by our representative in Farmington. We have submitted the Sundry Notice Report to the U.S.G.S., a copy of which is attached for your information.

We are sorry for our delay in filing these reports, and if there are any further questions, please feel free to contact me.

Yours very truly,

TENNECO OIL COMPANY

A handwritten signature in cursive script, appearing to read "J.L. Gaskill".

J.L. Gaskill
Division Production Engineer



RDS:pm

Attachments

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

Jicarilla Cont. 110

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Jicarilla A

9. WELL NO.

1

10. FIELD AND POOL, OR

Basin Dakota & Blanco MV

11. SEC., T., R., M., OR BLE. AND
SURVEY OR AREA

Sec. 18, T26N, R5W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

1200 Lincoln Tower Bldg., Denver, Colorado 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface

1820' FSL and 1130' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DP, RT, GR, etc.)

6599' GR

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

☒(NOTE: Report results of multiple completion or Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting the
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertain-
ent to this work.)*

Packer leakage has been repaired, as follows:

1. MPRU pulling unit and unseated seal assembly from Mod "N" pkr.
2. Circulated hole with hot oil to remove paraffin and scale.
3. Pulled thg and redressed seal assembly, replaced blast jts and sliding sleeve.
4. FTH, hydrotested thg, stung into Mod "N" pkr.
5. Swabbed in Dakota.
6. Placed on line.
7. Fan packer leakage test 8/10/74.

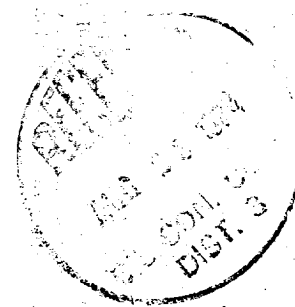

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Sr. Production Clerk

DATE

8/19/74

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: