November 1983) Formerly 9-331)	UNITED STATES DEPARTMENT OF THE INTERIC	nummer in Triplicates (Other instructions on re-	Budget Bureau No. 1004-0135 Express August 31, 1985 5. LEASE DESIGNATION AND SEELED NO.
	BUREAU OF LAND MANAGEMENT		SF 079035-A
SUNDRY NOTICES AND REPORTS ON WELLS (Do not use thin form for proposals to drill or to deepen or plug back to a different reservoir, Use "APPLICATION FOR PERMIT—" for such proposals.)			G. IP INDIAN, ALLOTTER OR THISE NAME
OIL WELL M	OTHER		T. UNIT ADDEEMENT NAME
2. NAME OF OPERATOR			8. FARM OR LEADE HAME
3. ADDRESS OF OPERATOR	Caulkins Oil Company		Breech "A"
			9. WALL NO.
P.O. Box 780 Farmington, New Mexico 1. Location of wall (Report location clearly and in accordance with any State requirements.)			204
See also space 17 below.) At sprince			10. FIELD AND FOOL, OR WILDCAT
760' F/S and 660' F/E RECEIVED			S. Blanco Tocito-Basin Dakota
14. PERMIT NO. 15. ELEVATIONS (Show whether Dr. RT. CR. etc.)			Section 9, 26 North West
OUTO KD			Rio Arriba New Mexico
BUREAU OF LAND MANAGEMENT SAPMINGTON PERSONNENT TO:			
LAMMINGTON MESON	RCE AREA	8011100	ANT REPORT OF:
TEST WATER SHUT-OFF	PCLL OR ALTER CASING	WATER BUUT-OFF	PERMISSING MELL
BHOOT OR ACIDIES	ABANDON*	PRACTURE TREATMENT	ALTERING CABING
REPAIR WELL	XX CHANGE PLANS	(Other)	ABANDONNERT"
(Other) [Nors: Report results of multiple completion on Well			
27. BEAUAIDE PROPURED OR CUSIFICATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any nent to this work.) 18. DERIVATION OF RECOMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any nent to this work.)			
7-14-86 Casing failure suspected on this well. Temperture survey run when well cemented 12-25-55 shows cement top at 4985'. We propose to pull 2 3/8" tubing with packer now set in well, then set Bridge Plug at approx 5200' to shut off Tocito and Dakota Zones from below. 7" casing will then be tested for leak. Leak will be isolated to determine depth. To repair we propose to perforate 7" casing above cement top and then cement behind 7" casing from 4985' to surface by what ever means necessary to accomplish. After cementing 7" casing will be tested to 2000#. After repairs completed Bridge Plug will be recovered then well will be completed in Tocito and Dakota Zones with 1 1/2" EUE tubing run to Dakota and 2 3/8" EUE Tubing run to Tocito. No new surface disturbance.			
18. 1 hereby cortife that the f	ocesoing is true and correct		
SIGNED Skel	Super TITLE Super	intendent	1 CAPPROVED
(This space for Pederal or			HATE TO THE TOTAL PROPERTY OF THE PROPERTY OF
	Diane valet user	€ 10 ± 10 ± 10 ± 10 ± 10 ± 10 ± 10 ± 10	157. 3
APPROVED BYCONDITIONS OF APPROV	VAL IF ANT		DATE
e L	*See Instructions on RIMOC	Revene Side	FARMANIA AND AND AND AND AND AND AND AND AND AN

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.