

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
Tract 251-Contract 154

6. If Indian, Allottee or Tribe Name

Jicarilla Apache

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Jicarilla Apache # 12

9. API Well No.

30-039-20002

10. Field and Pool, or Exploratory Area

Jicarilla, M. Verde, BD

11. County or Parish, State

Rio Arriba Co., N M

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Marathon Oil Company

3. Address and Telephone No.

P.O. Box 552 Midland, Tx. 79702

915-687-8324

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UL "A" 800' FNL & 800' FEL

SEC 33, T-26-N, R-5-W

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☒ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Marathon Oil Co. is proposing to recomplete the Mesa Verde and dual with the existing Dakota completion. The completion will be accomplished using a concentric coiled tubing design. The proposed procedure is attached.

RECEIVED
JUN - 8 1994
OIL CON. DIV.
DIST. 8

14. I hereby certify that the foregoing is true and correct

Signed

Thomas M. Price **Thomas M. Price**

Title **Advanced Engineering Technician**

Date **5-11-94**

(This space for Federal or State office use)

Approved by

St. Joseph Jaramilla

Title **Chief, Lands and Mineral Resources**

Date

JUN 6 1994

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See instruction on Reverse Side

NMCO

WORKOVER PROCEDURE

JICARILLA APACHE WELL NO. 12
800' FNL and 800' FEL
Section 33, T-26-N, R-5-W
Jicarilla Field
Rio Arriba County, New Mexico

Date: April 25, 1994

AFF NO.: 656394

Purpose: Recomplete to Mesaverde and dual with existing Dakota using concentric coiled tubing design.

Elevation: 6,554' KB; 6,541' GL

TD: 7,355' PBTD: 7,330'

Surface Casing: 10-3/4", 32.75#, H-40 set at 419'. Cement w/475 sx. Circulate cement to surface.

Intermediate Casing: 7-5/8", 24#, H-40 set at 3,004' KB. Cement w/600 sx. Circulate cement to surface.

Production Casing: 4-1/2", 11.6#, J-55 set at 7,353' KB. DV tool @ 5,379' KB. Total cement both stages - 543 sx. Temp log indicates TOC @ 2,550' KB.

Production Tubing: 222 joints 2-3/8", 4.7#, J-55 (220 joints) and N-80 (top 2 jts) set @ 7,051', Baker Model "F" profile nipple from 7,051'-52', 6' X 2-3/8" perforated sub from 7,052'-58'.

Current Completion: Lower Dakota Sand: 7,238'-44', 7,251'-55', 7,293'-96', 7,299'-7,303' (34 holes).

Upper Dakota Sand: 7,207'-12', 7,217'-22' (20 holes)

Graneros: 7,074'-84' (20 holes)

Drilling Mud Weight: Drilled with gas (mudded up to 8.6 ppg to run casing).

Estimated BHP: 900 psi - DK; 1,600 psi - MV

Estimated Surface Shut-In Pressure: 750 psi - DK; 1,000 psi - MV

Expected Reservoir Fluids: Gas with condensate and water.

Safety Considerations:

- Hold safety meeting explaining the procedure.
- Well work will be performed with well live.

Other Considerations:

- Try not to put water on formation.
- Obtain Jicarilla Apache Tribe work permit (call E. A. Nelson). All contractors and MOC personnel must have permit in vehicle at all times.
- Obtain BLM approval for recompletion (call T. M. Price).

1. Install and test safety anchors to 22,500#.
2. RU wireline unit with lubricator.
3. RIH with sinker bar and tag PBTD at 7,330' KB to check for fill over Graneros/Dakota perfs (7,074'-7,303'). If perfs covered, clean out fill with 1-1/4" coiled tubing and N₂ foam to PBTD (7,330' KB).

4. RIH with 1.81" Baker "F" plug with top No-Go on running tool and set in "F" nipple at 7.051' KB.
5. Dig, line, and fence pit. Build large wall on downwind side. Lay 2" line to pit and stake down. Blow well down to pit through casing valves.
6. MIRU PU. ND wellhead and master valve.
7. NU hydraulic BOP assembly with blind rams on bottom and 2-3/8" pipe rams on top. Install 7-1/16" X 5-1/2' drilling spool with 7" Blooie line to pit with 4-1/16" valve. Install Rector stripping head on top of spool.
8. Open 7" line to pit and finish blowing down well after unlocking tubing hanger mandrel. Test BOP. Strip out of hole with 2-3/8" tubing with well flowing to pit.
9. RU wireline unit with lubricator.
10. RIH under pressure with GR-CCL and Baker 4-1/2" - 43A wireline set RBP (maximum OD = 3.771" and length = 60" with retrieving head) and set RBP at 5.350' KB (stage tool at 5.379'). Spot 1 sx of sand on top of RBP.
11. Load hole with 2% KCl water.
12. Test casing to 1000 psi with rig pump.
13. RU loggers and packoff. RIH with GR-CBL-CCL to PSTD of 5.350'. Log well under 1,000 psi if microannulus present. Pull log to 200' over TOC.
14. If bond appears good, RU lubricator to perforate Mesaverde/Point Lookout. If no cement across proposed Point Lookout perforations, prepare to squeeze.
15. Perf Point Lookout pay with 3-1/8" casing gun using 2 JSPF, 180° phasing as follows: 5,107'-5,111', 5,115'-30', 5,133'-40', 5,179'-82', 5,190'-99', 5,221'-25', and 5,256'-62'.
16. RD loggers. Change out pipe rams to 2-7/8".
17. Pick up and RIH with Baker Model "C" Fullbore packer (maximum OD = 3.771" and length = 78" in running position), 1.875" Baker Model "R" profile frac nipple with bottom No-Go, 2' X 2-7/8" pup joint, 1.875" Baker Model "F" profile frac nipple on 2-7/8", 6.5#, N-80 workstring, hydrotesting to 9,500 psi.
18. Set packer at \pm 5,007'.
19. RU stimulation company. Breakdown with 2% KCl water, open bypass and circulate acid down to packer, close bypass and acidize with 7-1/2% NEFE acid, dropping ball sealers to divert.
20. Unset packer and knock balls off perfs. PUP and reset at \pm 5,007'.
21. Prepare to frac well. Quality control frac fluids and proppant.

22. Frac Mesaverde/Point Lookout perms (5,107'-5,262') down 2-7/8" workstring at 25 BPM as follows with 72,500 gal of 65 quality N₂ foam and 167,500# proppant using:

- 30# Linear Gel (Guar)
- 20/40 Brady (Vulcan Texsan) Proppant

STAGE	FOAM VOLUME	SAND
Pad	20,000 gal	--
1 ppg	10,000 gal	10,000#
2 ppg	10,000 gal	20,000#
3 ppg	10,000 gal	30,000#
4 ppg	10,000 gal	40,000#
5 ppg	7,500 gal	37,500#
6 ppg	5,000 gal	30,000#
Flush	1,200 gal	--
TOTAL	73,700 gal	167,500#

Shut well in for 30 minutes to rig up flowback manifold as per attached diagram and RD service company. Open well up on 8/64" positive choke and flowback well to frac tank. Divert well to lined pit when gas is to surface.

23. Leave well open to frac tank to flow back overnight.
24. If well dies, release Baker Model "C" Fullbore packer and POOH with 2-7/8" workstring, laying down and go to Step 25. If well continues to flow, release packer and dump packer fluid on formation, open backside and Blooie line to pit, and POOH with 2-7/8" work string and packer, laying down (well should be dead). If well is not dead, RIH with 1.875" Baker Model "R" plug and strip out of hole.
25. Change out pipe rams to 2-3/8" and RIH with 4-1/2" - 43A RBP retrieving head. 1.875" Baker Model "R" profile frac nipple with bottom No-Go, 2' X 2-3/8" pup joint. 1.875" Baker Model "F" profile frac nipple on 2-3/8", 4.7# tubing. Tag fill. If fill covers perms 5,107'-5,262', then RU nitrogen truck. Install string float. Clean out with N₂ foam to 5,300' KB (do not latch on to RBP @ 5,350'). PUH and land 2-3/8" tubing at ± 5,107'. If fill not covering perms, PUH and land 2-3/8" tubing at ± 5,107'. NU wellhead.
26. Kick well off flowing. RU swab if well dies.
27. RD pulling unit.
28. Turn well through test unit and monitor gas, oil, and water rates and pressures.
29. Test well for one week allowing well to clean up and any possible back flow of sand into wellbore.
30. RU pulling unit and stripping BOP assembly. Open backside and 7" Blooie line to pit and blow down well.
31. RU nitrogen unit. Install string float and RIH and cleanout to PBTD (5,350') with N₂ foam. Latch on to RBP @ 5,350' with retrieving head. RU wireline and set plug in 1.875" Baker Model "R" profile frac nipple.
32. Strip out of hole with 2-3/8" tubing. Close blind rams on BOP.

33. Open blind rams on BOP and strip in hole with Baker 2-3/8" X 1.812" Model R profile nipple with bottom No-Go with plug in place. \pm 1,700' of 2-3/8", 4.7# production tubing, Baker 4-1/2" X 2-3/8" Model A-3 Lok-Set packer (maximum OD = 3.771" and length = 37"), 1 joint 2-3/8", 4.7# tubing, Baker 2-3/8" X 1.812" Model F profile nipple, 1 joint 2-3/8", 4.7# tubing, (8) 20' X 2-3/8" X 3.063" blast joints (across Point Lookout perfs 5,107'-5,262'), 10' X 2-3/8" pup joint, Baker 2-3/8" X 1.875" Model L sliding sleeve, and 2-3/8", 4.7# tubing to surface. Land packer \pm 5,350' KB and bottom of tailpipe \pm 7,050' KB.
34. Land tubing hanger mandrel in bowl. Lock down pins to create seal.
35. ND BOP. NU master valve portion of tree only.
36. RU wireline unit with lubricator.
37. RIH and shift Baker 1.875" Model L sliding sleeve open. RD wireline unit.
38. RU swab. Swab Mesaverde (upper zone) and kick off flowing. RD swab and pulling unit.
39. Evaluate/monitor gas and water rates from Mesaverde prior to running coiled tubing in Step 41.
40. RU wireline unit and lubricator. Retrieve plug in Baker 1.812" Model "R" profile nipple. RD wireline unit.
41. RU coiled tubing unit.
42. Install coiled tubing wellhead hanger assembly (CTWHA) body on top of master valve. Install outlet valves on CTWHA.
43. Install pipe rams (4-1/16" X 10M-Bowen) with 1.5" OD guides with adapter flanges on top and bottom.
44. Install quad BOP's, access window, and injector head on top of pipe rams. Installation assembly must line up vertical (no leaning) to ensure proper landing of CTWHA pack-off. Measure distance from CTWHA hanger seat to set mark in access window -- measured length (ML).
45. Open master valve and RIH with \pm 1,913', 1.5" OD (0.125" wall with internal weld removed) CT tailpipe with pump-out plug on bottom. Set slips.
46. Close pipe rams. Bleed off pressure above. Open access window. Cut CT and install seal assembly with roll-on connectors (top and bottom). Be sure not to overstress roll-on connections.
47. Close window. Open pipe rams. Release slips. RIH with \pm 5,306', 1.5" OD (0.125" wall) CT and land seal assembly in Baker 1.812" Model F profile nipple at \pm 5,316' KB with 3,000# compression and bottom of CT tailpipe at \pm 7,230' KB. Mark coiled tubing. Pick CT up ML distance above set mark in access window. Set slips.
48. Close pipe rams. Bleed off pressure above. Open access window. Install split clamps (above and below pack-off), split pack-off assembly and segmented wraparound slips around 1.5" OD CT. Close access window. Open pipe rams. Release slips.
49. RIH ML distance and land slips and pack-off in CTWHA. Fully lock down pins to energize pack-off.
50. Bleed off pressure on coil using valve on end of reel (N₂ used to pressure test tubing combined with elevation and temperature change will expand and put pressure on coil). Verify pump out plug is holding. Open access window. Cut CT.
51. Remove injector head, access window, quad BOP's. ND pipe rams (remove with local crane).

52. Make final tubing cut 6"-8" above CTWA. Install pre-assembled production tree (see production set-up figure).
53. RU nitrogen unit on top swab valve of tree assembly. Pump out plug w/30,000 scf-N₂ @ 500 scf/min and max pressure of 2,000 psig. Immediately blow back N₂. When fluid hits surface, turn well through separator and blow to tank for 5 hours to unload near wellbore fluids. Turn well into Marathon's Jicarilla gas gathering system.
54. Monitor gas, oil, and water rates and flowing pressures.

R. W. Tracy
Operations Supervisor
Midland Operations

T. B. Arnold
Drilling Superintendent
Midland Operations

MARATHON OIL COMPANY

JICARILLA APACHE WELL NO. 12

PROPOSED PERFS

5100

5107-5111

5115-5130

5133-5140

5179-5182

5190-5199

5200

5221-5225

5256-5262

5274

5300

5107-5111
5115-5130
5133-5140
5179-5182
5190-5199
5221-5225
5256-5262
5274

BASE
MESAVERO