Form 3160-5 (November 1994)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

MUDDA	NOTICES	AND	DEDODTS	ON	WEI	

Do not use this form for proposals to drill or to re-enter an

FORM APPRO	
Budget Bureau No.	1004-0135
Expires July 31,	1996

5. Lease Serial No.

Trac	t	251	_/	Contract	154
				ee or Tribe Nam	

	n 3160-3 (APD) for such proposals.	기 기 기 기 기 기 기 기 기 기 기 기 기 기 기 기 기 기 기
SUBMIT IN TRIPLICATE	Other instructions on reverse side	7. If Unit or CA/Agreement, Name and/or No.
3a. Address	MAR 2000  RECON DIV  3b Phone No. (include area code)  (505) 393-7106	8. Well Name and No. Jicarilla Apache 14E DHC #1111  9. API Well No. 30-039-22591  10. Field and Pool, or Exploratory Area Jicarilla Basin Dakota / Mesa Verde
TWL COOL DIED THE VCOL		11: County or Parish, State Rio Arriba NM
12. CHECK APPROPRIA	ATE BOX(ES) TO INDICATE NATURE OF NOTICE, F	REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF A	CTION
Notice of Intent    X   Subsequent Report   Final Abandonment Notice	Alter Casing Fracture Treat I  X Casing Repair New Construction  Change Plans Plug and Abandon	Production (Start/Resume) Water Shut-Off  Reclamation Well Integrity  Recomplete Other  Temporarily Abandon  Water Disposal
Attach the Bond under which the work will be perfollowing completion of the involved operations. If	y state all pertinent details, including estimated starting date of lete horizontally, give subsurface locations and measured and formed or provide the Bond No. on file with BLM/BIA. Re the operation results in a multiple completion or recompletion otices shall be filed only after all requirements, including re.)	true vertical depths of all pertinent markers and zones.  quired subsequent reports shall be filed within 30 days  in a new interval a Form 3160.4 shall be filed

- 1/18 MIRU pulling unit. POOH w/pump & rods. ND wellhead. NU BOP. Rel on/off tool. POOH w/chemical string. RIH, latch on/off tool. Rel TAC at 4855'. POOH w/prod tbg. RIH w/RBP & pkr. Set RBP at
- 4900', pkr at 4880'. Isolate csg leak between 599-722'. Rel pkr, POOH. Dump 2 sx sand on RBP. 1/21 RIH w/pkr, set at 350'. Mix & pump 150 sxs Class B cmt. Rel pkr, POOH. RIH w/bit & dc's. Tag top of
- cmt at 550'. DO 550-2415'. Circ hole clean. 1/27 Test squeeze & csg to 500 psi, OK. RIH, tag top of sand at 4885'. Circ sand off RBP. POOH w/bit & dc's. RIH w/bit & scraper to 2700', POOH. RIH w/retreiving tool, tag RBP. Circ clean. Swab. Rel RBP, POOH.
- 1/29 RIH w/2 3/8" prod tbg. Rel on/off tool. Install TIW valve.
- 1/30 RIH w/chemical string. ND BOP. NU wellhead. Pump 1000 gals 15% NEFE. RIH w/pump & rods.
- 1/31 RD pulling unit.

TAC at 4854' SN at 7330' End of tbg 7355'

which would entitle the applicant to conduct operations thereon.

4. I hereby certify that the foregoing is true and correct Name (Printed/Typed)  Kelly Cook	Records Processor		
, ( J	Date 2/4/00		
THIS SPACE FOR	FEDERAL OR STATE OFFICE USE		
Approved by	Tands and Mineral Fresources Date 1/3 5/0 0		
Conditions of approval, if any, are attached. Approval of this notice does certify that the applicant holds legal or equitable title to those rights in the	not warrant of Office		

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.