Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT	
RY NOTICES AND REPORTS ON WELLS e this form for proposals to drill or to re-enter a	n

PORM APPROVED OMB NO. 1004-0135 xpires: November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on reverse side. 1. Type of Well Oil Well Gas Well Other Contact: PEGGY COLE						5. Lease Serial No. JIC CONTRACT 150 6. If Indian, Allottee or Tribe Name 7. If Unit or CA/Agreement, Name and/or No. 8. Well Name and No. JICARILLA 150 7R 9. API Well No. 30-039-24076		
BURLINGTON RESOURCES	E-Mail: pbradfield@br-inc.com 3b. Phone No. (include acacode)			10. Field and Pool, or Exploratory				
3a. Address 3401 EAST 30TH FARMINGTON, NM 87402	Ph: 505.326.9727			BASIN DAKOTA				
4. Location of Well (Footage, Sec., T.	i) [े ००	1 500.	11. County or P				
Sec 11 T26N R5W NENE 115	E B			RIO ARRIBA COUNTY, NM				
12. CHECK APPR	OPRIATE BOX(ES) TO	O INDICATE NA	TURE OF N	IOTICE, R	EPOŔT, OR O	THER !	DATA	
TYPE OF SUBMISSION		TYPE OF ACTION						
□ Notice of Intent☑ Subsequent Report□ Final Abandonment Notice	absequent Report □ Casing Repair □ Change Plans □ Convert to Injection			□ Deepen □ Production (Start/Recomplete □ Recomplete □ Removement □ Recomplete □ Temporarily Aband □ Plug Back □ Water Disposal			☐ Water Shut-Off ☐ Well Integrity ☐ Other imate duration thereof.	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 39-21-01 MIRU. ND WH. NU 19-24-01 TOOH w/2 3/8" tbg. to 2600'. SDON. 9-25-01 TOOH w/4 3/4" mill. through tight spot @ 2600'. S9-26-01 Mill @ 2600-2602'. TIH w/1 11/16" chemical cutts 9-27-01 TIH w/fishing tools. 9-28-01 TIH w/4 3/4" tapered clean. SD for weekend. 10-1-01 Mill on scale @ 298 10-2-01 Mill through tight spots.	any of recomplete incomplete in the control of operations. If the operation is bandonment Notices shall be final inspection.) BOP. SD for weekend. TIH w/4 3/4" junk mill to TIH w/3 7/8" mill to 3240: DON. TIH. Stuck mill @ 2863'. er. Chemical cut 2 3/8" the Fishing. TOOH w/fish & d mill to 2682'. Work mill 9-3500'. Circ hole clean. ot @ 3500-3502'. Pump	le the Bond No. on file results in a multiple co filed only after all requested only after a supply a supply a supply a supply	with BLM/BI npletion or re- irements, inclu II. TIH w/4 3 H w/3 7/8' I DH. TIH w/fi I w/2 3/8" Ib N. 6 @ 2682-:29 down tbg. I	A. Required a completion in ading reclamate 3/4" tapered mill. Work ree point. T. g. SDON. 989'. Circ h. Displace w/	subsequent reports a new interval, a Fion, have been con immediately mill mill ooh.	shall be 1	filed within 30 days	
14. I hereby certify that the foregoing	For BURLINGTON Committed to AFMSS 1	for processing by A	ngie Mediria		0/11/2001 ()			
Name (Printed/Typed) PEGGY								
Signature (Electronic Submission) Date 10								
	THIS SPACE	FOR FEDERAL	OR STAT	E OFFICE	USE	т		
_Approved By	÷		Læmeis an	d Mineral	Pasoucas	Date	10/15/4/	
Conditions of approval, if any, are attac certify that the applicant holds legal or which would entitle the applicant to co	emmanie mie to mose ngnes n	does not warrant or n the subject lease	Office				an agency of the United	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Additional data for EC transaction #7838 that would not fit on the form

32. Additional remarks, continued

wtr. SDON.

10-3-01 (Verbal approval to plug and abandon well from Brian Davis, BLM). TOOH w/mill. TIH w/4
3/4" tapered mill. Tag tight spot @ 3280'. Blow well & CO. Mill through tight spots @ 3280-3410'.
Circ hole clean. SDON.

10-4-01 TOOH w/mill. TIH w/4 3/4" junk mill to 4073'. Work throught tight spot @ 4073. TOOH
w/mill. SDON.

10-5-01 TIH to 8009'. Establish circ. SD for weekend.

10-8-01 Pump 40 bbl wtr down tbg. Establish circ. Plug #1: pump 35 sx Class "B" neat cmt @
7635-8000'. Displace w/29 bbl wtr. TOOH. WOC. TIH, tag TOC @ 7700'. TOOH to 6633'. Plug #2: pump
20 sx Class "B" neat cmt @ 6533-6683'. TOOH to 5470'. Plug #3: pump 20 sx Class "B" neat cmt @
5319-5470'. TOOH to 3550'. SDON.

10-9-01 Plug #4: pump 20 sx Class "B" neat cmt @ 3673-3823'. TOOH to 3550'. Plug #5: pump 20 sx
Class "B" neat cmt @ 3400-3550'. TOOH to 3250'. Plug #6: pump 15 sx Class "B" neat cmt @
3150-3250'. TOOH to 2350'. Plug #7: pump 25 sx Class "B" neat cmt @ 2150-2350'. TOOH. TIH, perf 4
sqz holes @ 373'. Establish circ out bradenhead. TIH w/5 1/2" cmt retainer, set @ 320'. Plug #8:
pump 165 sx Class "B" neat cmt down tbg. Circ 5 sx cmt to surface. Sting out of cmt retainer. Pump
50 sx Class "B" neat cmt. Circ 5 sx cmt to surface from csg. ND BOP. Cut off WH. Ins:all dry hole
marker w/5 sx Class "B" neat cmt. RD. Rig released.

Well plugged and abandoned 10-9-01