Form 9-331 (May 1963)

UNITED STATES SUBMIT IN TRIPLICATE Other instructions on reverse side) UNITED STATES

Form approved,
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

6. IF INDIAN, ALLOTTEE OR TEIBE NAME

REPAIRING WELL

SF 078062

GEOLOGICAL SURVEY								
SUNDRY	NOTICES	AND	REPORTS	ON	WELLS			

NOTICE OF INTENTION TO:

PULL OR ALTER CASING

TEST WATER SHUT-OFF

FRACTURE TREAT

LEPAIR WELL

(Other)

SHOOT OR ACIDIZE

(Do not use this form for pror	carron FOR PERMIT—" for such proposals.)	· /	
OIL GAS WELL OTHER		7. UNIT AGREEMENT NAME Carson Unit	
2. NAME OF OPERATOR Shell Oil Company	8. FARM OR LEASE NAME		
3. ADDRESS OF OPERATOR	9. WELL NO.		
1700 Broadway, Denver	44-18		
4. LOCATION OF WELL (Report location See also space 17 below.) At surface 660 FSL & 659 FEL Se	10. FIELD AND POOL, OR WILDCAT Bisti 11. SEC., T., R., M., OR BLE. AND SURVEY OR AREA Section 18-T25N-R11W		
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6429.6 KB	NMPM 12. COUNTY OR PARISH 13. STATE San Juan New Mexico	
16. Check A	Appropriate Box To Indicate Nature of Notice, Report, o		

MULTIPLE COMPLETE FRACTURE TREATMENT ALTERING CASING X SHOOTING OR ACIDIZING X ABANDONMENT* ABANDON* CHANGE PLANS (Other) _

WATER SHUT-OFF

(Note: Report results of multiple completion on Weil Completion or Recompletion Report and Log form.)

SUBSEQUENT REPORT OF:

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See attachment



18. I hereby certify that the foregoing is true and correct		
signed for flanding	TITLE Div. Opers. Engr.	MAR 03 1977
(This space for Federal or State office use)		
APPROVED BY	TITLE	DATE

ACID TREAT & REPAIR PRT D ROD SHELL OIL COMPANY BISTI LEASE CARSON UNIT WELL NO. 44-18 DIVISION WESTERN FROM: 2/7 - 3/1/77ELEV 6429.6' KB COUNTY SAN JUAN STATE NEW MEXICO

NEW MEXICO
BISTI FIELD
Carson Unit 44-18
(AT & repair prt'd rod)

"FR" TD 5059. PB 4974. AFE #537007 provides funds to repair rod prt & AT. 2/2 MI&RU Farmington Well Service. Pulled rods & tag'd btm w/tbg @ 4974; split collar 125 jts down. 2/3 Ran csg scraper to 4974. Ran dump bailer (2 runs) w/3 sx cmt. SI for night.

FEB 07 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. 2/4 Ran bailer & tag'd PBTD @ 4938. Ran tbg w/pkr & 1 jt tail. With tail @ 4885, pmp'd 500 gals P121 solvent to perfs & set pkr. Foll'd solvent w/600 gals HCl blended w/80# OS-90 Unibeads & foll'd w/1000 gals HCl. Initial pmp rate 2 B/M @ 0 psi. Press incr'd to 800 psi when diverter hit perfs. FPP 1100 psi @ 4 B/M. Well went on vac after pmp'g stop'd. SI overnight. 2/5 Had vac on well. Pulled tbg & pkr. Ran pmp bbl & tbg & set anchor. Ran rods & plunger. Released Farmington & started pmp'g well. 2/6 Prod 225 B/D gross; 0 oil. 2/7 Prod 225 B/D gross; 97% cut - 7 BO/D.

FEB 08 1977

Carson Unit 44-18 (AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 0 9 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. Pmp'g. On 2/8/77 prod 13 BO & 203 BW. On 2/9/77 prod 12 BO & 204 EW.

FEB 1 0 1977

Carson Unit 44-18 (AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB ! 1 1977

Carson Unit 44-18 (AT & repair prt'd rod)

TD 5059. PB 4938. 2/10 In 24 hrs pmp'd 12 BO & 204 BW. 2/11 In 24 hrs pmp'd 7 BO & 204 BW. Field SD due to electrical problems 2/12/77. 2/13 In 24 hrs pmp'd 14 BO & 202 BW.

Carson Unit 44-18 (AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 1 5 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 1 6 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. 2/14 Pmp'd 197 BW & 14 BO. 2/15 Pmp'd 200 BW & 11 BO. 2/16 Pmp'd 243 BW & 16 BO. FEB 1 7 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 1 8 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 2 2 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEB 2 3 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

FEE 2 4 1977

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. No report.

5000 C = 1355

Carson Unit 44-18 TD 5059. PB 4938. 2/23 prod 276 B/D gross w/95% cut; (AT & repair prt'd rod) 14 BO/D. FL @ 3430'. Cum oil prod since AT 160 bbls.

Carson Unit 44-18
(AT & repair prt'd rod)

TD 5059. PB 4938. AT & REPAIR COMPLETE. On test before work, prod 2 BO/D & 60 BW/D. On test 2/23/77 after work, prod 14 BO/D & 262 BW/D.

FINAL REPORT

MAR 01 1977