

FEB 2 1953

Budget Bureau No. 42-R-359.3.
Approval expires 12-31-55.

(SUBMIT IN TRIPLICATE)

Indian Agency Isaia

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee Mary Itahia

Lease No. **14-20-603-1228**

SUNDRY NOTICES AND REPORTS ON WELLS

| | | |
|---|---|--|
| NOTICE OF INTENTION TO DRILL | | SUBSEQUENT REPORT OF WATER SHUT-OFF |
| NOTICE OF INTENTION TO CHANGE PLANS | | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF | X | SUBSEQUENT REPORT OF ALTERING CASING |
| NOTICE OF INTENTION TO REDRILL OR REPAIR WELL | | SUBSEQUENT REPORT OF REDRILLING OR REPAIR |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE | | SUBSEQUENT REPORT OF ABANDONMENT |
| NOTICE OF INTENTION TO PULL OR ALTER CASING | | SUPPLEMENTARY WELL HISTORY |
| NOTICE OF INTENTION TO ABANDON WELL | | |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 27 1956

Well No. 1 ~~Thompson~~ is located 330 ft. from S line and 990 ft. from E line of sec. 9

SW - SE - SE **23N** **12W**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Plot **San Juan** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mud logging jobs, cementing points, and all other important proposed work)

| | | | | | | | | | | | |
|--------|------|----|-----|-----|-------|----|-----|------|---|------|------|
| Ran 25 | Jts. | 7" | 23# | J55 | Range | 28 | rd. | thd. | A | cord | eng. |
| 130 | Jts. | 7" | 20# | " | " | " | " | " | " | " | " |
| 1 | Jts. | 7" | 23# | " | " | " | " | " | " | " | " |

768.76
4083.58
10.16
2.83

On top of string. Float collar & shoe
Total of 4867.30' of pipe set at 4880.25. w/centralizers on pipe @ 4856, 4814,
4784, 4752, 4661 & 4631. Cemented w/150 sacks common cement. Found cement all
left in pipe. Drilled out. Ran retainer set going in hole @ 3714. Recemented
w/200 sacks displacing w/water. Drilled retainer found no cement in csg. Set 2nd
retainer @ 4846 attempted squeeze could not pump, held 3500# for 10 min. Ran B & R
temperature survey showed good cement to 3740.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company PHILLIPS PETROLEUM COMPANY

Address 706 Ridgcrest Drive SE

Albuquerque

By Earl Sturm *Earl Sturm*

New MacLao

Title Dist. Sect.