Form 9-331 (May 1963)	UNITED STATES DEPARTMENT OF THE IN GEOLOGICAL SURV	NTERIOR (Other instructions on re	
	NDRY NOTICES AND REPO s form for proposals to drill or to deepen of Use "APPLICATION FOR PERMIT—" for		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
OIL GAS WELL	OTHER		7. UNIT AGREEMENT NAME Carson Unit
2. NAME OF OPERATOR Shell Oil Company 3. ADDRESS OF OPERATOR			8. FARM OR LEASE NAME Unit
1700 Broadway	9. WELL NO. 33-11		
See also space 17 be At surface	Report location clearly and in accordance work.) 980' FEL Section 11	vith any State requirements.*	10. FIELD AND POOL, OR WILDCAT Bisti 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 11-T25N-R12W
14. PERMIT NO.	15. ELEVATIONS (Show wi	hether DF, RT, GR, etc.)	12. COUNTY OR PARISH 13. STATE San Juan N.M.
TEST WATER SHUT- FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL (Other) 17. DESCRIBE PROPOSED proposed work, nent to this work.	PULL OR ALTER CASING MULTIPLE COMPLETE ABANDON* CHANGE PLANS OR COMPLETED OPERATIONS (Clearly state all f well is directionally drilled, give subsurf.	WATER SHUT-OFF FRACTURE TREATMENT SHOOTING OR ACIDIZING (Other) (Note: Report results Completion or Recomp pertinent details, and give pertinent dates ace locations and measured and true vertice	REPAIRING WELL ALTERING CASING ABANDONMENT* S of multiple completion on Well oletion Report and Log form.) including estimated date of starting any
CLEANED AND F	AL SUNDRY WHEN LOCATION EADY FOR INSPECTION		

cc: NMO&GCC

PLUG & ABANDON		
SHELL OIL COMPANY	LEASE CARSON UNIT WELL NO	
FROM: 9/19/77	DIVISION WESTERN ELEV 6361 KB	-
	STATE NEW MEXICO	-

NEW MEXICO
BISTI FIELD
Carson Unit 33-11
(P&A)

"FR" TD 5045. PB 5025. AFE #529646 provides funds to plug & abandon well. 9/15 RU Bedford. Ran workstring to PBTD. Spt'd 20 sx cmt plug across & over Gallup perfs. Pulled workstring out of hole. 9/16 Set jacks. Shot csg @ 1195 & spt'd 50 sx cmt plug over csg stub - Pictured Cliffs & Fruitland Coal. Pulled csg to 390 & spt'd 35 sx cmt plug over Ojo Alamo Sd. Pulled csg to 177' & spt'd 25 sx cmt plug over sfc csg stub. Pulled rest of csg out of hole. Placed 10 sx cmt plug on sfc. Set abandonment marker & RD Bedford.

SEP 1 9 1977