

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

Sundry Notices and Reports on Wells

1. Type of Well
GAS

97 DEC -8 PM 1:48

OYO FACILITY, CON, NM

SF-079472
5. Lease Number
SE-079521A
6. If Indian, All. or
Tribe Name
7. Unit Agreement Name

2. Name of Operator

BURLINGTON
RESOURCES

OIL & GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

1800' FSL, 1175' FWL, Sec. 30, T-28-N, R-5-W, NMPM

San Juan 28-5 Unit
8. Well Name & Number
San Juan 28-5 U #20
9. API Well No.
30-039-07310
10. Field and Pool
Blanco Mesaverde
11. County and State
Rio Arriba Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment

Type of Action

☐ Abandonment ☐ Change of Plans
☐ Recompletion ☐ New Construction
☐ Plugging Back ☐ Non-Routine Fracturing
☐ Casing Repair ☐ Water Shut off
☐ Altering Casing ☐ Conversion to Injection
☒ Other - Tubing repair

13. Describe Proposed or Completed Operations

It is intended to repair the tubing in the subject well according to the attached procedure.

RECEIVED
DEC 11 1997OIL CON. DIV.
DIST. 3

14. I hereby certify that the foregoing is true and correct.

Signed [Signature] (ROS8) Title Regulatory Administrator Date 12/7/97

(This space for Federal or State Office use)

APPROVED BY [Signature] Title _____ Date DEC - 9 1997

 
CONDITION OF APPROVAL, if any:

NMCCD

San Juan 28-5 Unit # 20
Mesaverde
1800' FSL 1175' FWL
Unit L, Section 30, T-28-N, R-05-W
Latitude / Longitude: 36° 17.88' / 107° 47.80'
DPNO: 49791A
Tubing Repair Procedure

1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify **BROG Regulatory (Peggy Bradfield 326-9727)** and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If casing requires clean out, TIH with bit and bit sub and CO to PBTD prior to running casing scraper. Roundtrip casing scraper and bit to below perforations. (Do not clean out with casing scraper.) PU above perforations and flow the well naturally, making short trips for clean up when necessary. TOOH.
5. TIH with 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Rabbit all tubing. CO to PBTD.
6. Land tubing near 5618'. ND BOP and NU wellhead. Pump off expendable check. Obtain final pitot gauge up the tubing. If well will not flow on its own, make swab run to seating nipple. If a swab run is not necessary, run a broach on slickline to ensure that the tubing is clear. RD and MOL. Return well to production.

Recommended: 
Operations Engineer

Approved:  11/26/11
Drilling Superintendent

R. O. Stanfield, Jr.
Office - (326-9715)
Home - (327-7646)
Pager - (324-2674)