

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 080516

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

San Juan 28-5 Unit

8. FARM OR LEASE NAME

San Juan 28-5 Unit

9. WELL NO.

91

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREASec. 14, T-28-N, R-5-W  
NMPM

14. PERMIT NO.

15. ELEVATIONS (Show whether DP, RT, GR, etc.)

6852'GL

12. COUNTY OR PARISH

Rio Arriba

13. STATE

NM

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐  
☐  
☐  
☐

PULL OR ALTER CASING

☐  
☐  
☐  
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☒  
☐  
☐  
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Fishing and sidetracking

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

☐  
☐  
☐  
☒(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

## 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 7-22-73 TD 4078'. Ran 130 joints 7", 20#, KS intermediate casing, 4065' set at 4078'. Cemented with 250 cu.ft. cement. WOC 12 hours, held 1200#/30 minutes. Top of cement at 3200'.
- 7-27-73 Drilled to 8214' and attempted to log well. Could not get to bottom with logs as gas drilled hole was wet. Mudded up well.
- 7-28-73 Mudding up and attempting to clean out to bottom.
- 7-29-73 Stuck bit at approximately 6566'. Backed off drill pipe at 5941', top of drill collars. Left 21 4 3/4" drill collars and bit in the hole.
- 7-30- to 8-4-73 Fishing for drill collars without success. Indications are that fish is imbedded in wall of hole and possibly covered with metal debris. Spotted a 165 cu.ft. cement plug through drill pipe at 5312'.
- 8-5-73 Set cement retainer at 3992' and squeezed approximately 134 cu.ft. cement below retainer
- 8-6-73 Drilled retainer and cement to 4095'. Began sidetracking at 4095'.

## 18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Drilling Clerk

DATE

August 14, 1973

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

AUG 15 1973