

Texas Rose Petroleum Inc.  
El Poso Ranch #2 N-14-28N-1E

Downhole conditions and equipment

7" casing at 120' with 59 cu. ft of cement  
4 1/2" casing at 1710' with 218 cu. ft of cement *CB*  
2 3/8" tubing at 1535'

Division Approved Plugging Program

1. Set a cement plug inside casing from plugback total depth at 1535' to 1385'.
2. Wait on cement a minimum of 3 hours. Go in hole with tubing and tag plug #1. If plug is in place go to step 3. If not fill to 1385'. *3* Come out of hole to 850' and set a cement plug inside casing 850'-650'. Come out of hole with tubing.
- 4* Take a strain on 4 1/2" casing to make sure cement was circulated. If stretch indicates casing is free below base of surface pipe, perforate casing at free point and circulate cement to surface. If no stretch is indicated circulate cement 170' to surface inside casing.
- 5* Set a dry hole marker, fill pits, clean and level location.

All plugs will be with neat cement with or without an accelerator.