

Texas Rose Petroleum Inc.
El Poso Ranch #7 O-14-28N-1E

Downhole conditions and equipment

8 5/8" casing at 80' with 59 cu. ft of cement
5 1/2" casing at 1290' with 272 cu. ft of cement *cg*
No tubing

Division Approved Plugging Program

1. Go in hole with tubing to TD. Set a cement plug 1290' to 1140'.
2. Wait on cement a minimum of 3 hours.
Go in hole with tubing and tag plug #1. If plug is in place go to step 3. If not fill to 1140'. } Come out of hole to 850'. Set a cement plug 850'-650' inside casing. Come out of hole with tubing.
4. Take a strain on 5 1/2" casing to make sure cement was circulated. If stretch indicates casing is free below base of surface pipe, perforate casing at free point and circulate cement to surface. If no stretch is indicated circulate cement 130' to surface inside casing.
5. Set dry hole marker, fill pits, clean and level location.

All plugs will be with neat cement with or without an accelerator.