

DOUTHIT #1 PC
UNIT C SECTION 26 T27N R11W
San Juan County, New Mexico
P & A Procedure


1. Install & test rig anchors. MI blow tank. MOL and RUSU (Bedford). Comply to all NMOCD, BLM, & MOI, rules & regulations. NU 6" BOP and stripping head. Test operation of rams. Install 2-7/8" relief line.
2. TOH w/ 2027' 1" tbg & laydown.
3. Run gauge ring on sand line to 1746' (50' above top FRT). TIH w/ 5-1/2" cmt ret on 2-3/8" tbg workstring & set @ 1746'. Sting out of ret & pressure test to 500 psi. Sting back into ret, est rate, & sq w/ 108 sx cmt. This will fill PC open hole & csg to 50' above top Fruitland w/ 100% excess cmt. PU & dump 5 sx cmt on top ret & reverse out. Pressure test csg to 500 psi. Circ hole w/ mud: 15# sodium bentonite w/ non-fermenting polymer, 9# gal weight, & 50 qs vis or greater.
4. Perf 2 sq holes @ 1127' (50' below top of Kirtland). TIH w/ 5-1/2" cmt ret on 2-3/8" tbg & set @ 1123'. With bradenhead valve open, est rate & pump 102 sx cmt into sq perfs. (This will cover backside of csg from 1127' to 890' (50' above top of Ojo Alamo w/ 100% excess cmt). If circ is obtained out bradenhead valve, continue pumping & circ cmt (about 241 sx). Close bradenhead valve, sting out of cmt ret & spot 32 sx cmt. This will fill inside of csg from 1127' to 890'.
5. A. If cmt has not circ out bradenhead valve, TOH. Perf 2 holes @ 275' (50' below surface csg shoe). Est rate & circ cmt down csg & out bradenhead valve (about 191 sx).
B. If cmt has circ out bradenhead valve, TIH w/ 2-3/8" tbg to 275' & circ cmt out csg (about 31 sx). TOH.
6. Cut off wellhead below surface casing flange and install dry hole marker to BLM specs. Release rig.
7. Restore location to BLM specs.

Approve: _____
J. B. Fraser

DOUTHIT #1 PC

UNIT C SECTION 26 T27N R11W
SAN JUAN COUNTY, NEW MEXICO

PRESENT

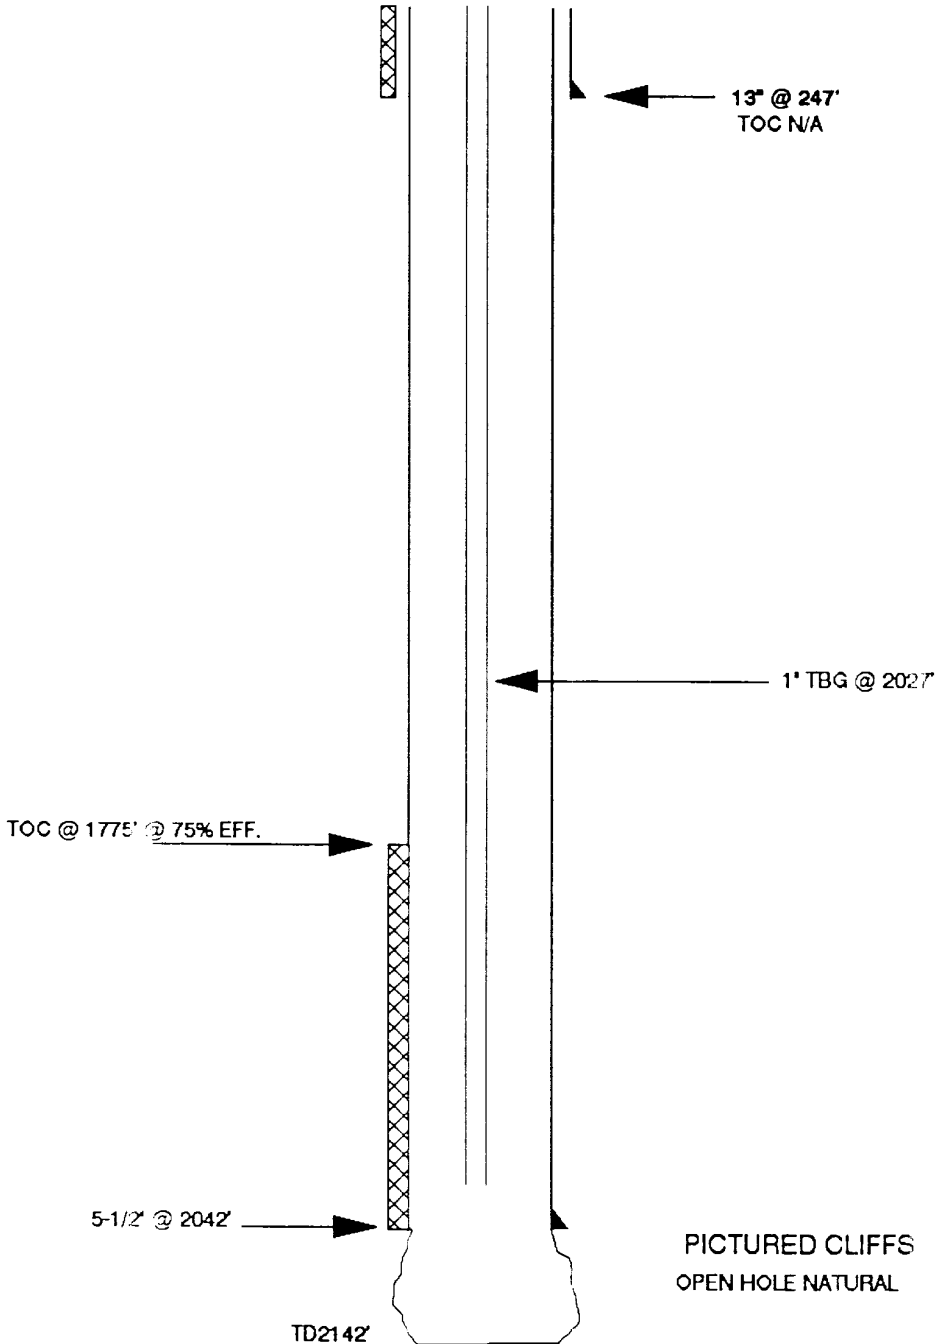

IN REPLY REFER TO
(019)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT
FARMINGTON RESOURCE AREA
1235 LA PLATA HIGHWAY
FARMINGTON, NEW MEXICO 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: #1 D-411

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal Leases."
2. Mark Kelly with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907
3. Blowout prevention equipment is required.
4. The following modifications to your plugging program are to be made (when applicable):

1) If cement has not circulated, perforate @ 297 (5' below surface csg) and circulate cement to the surface. If cement has circulated, spot a cement plug from 297 to surface in the 5' csg.

Office Hours: 7:45 a.m. to 4:30 p.m.