

June 7, 1992

Plugging & Abandonment Procedure - U. S. Argo #1 (Dk)
NW, Sec. 18, T27N, R10W
San Juan County, New Mexico

14. Plug #7 from 725' to 572' with 121 sxs Class B cement, squeeze 87 sxs outside casing; PO cement and then WOC. Tag cement and then spot mud from top of cement to 416', 3 bbls.; POH and LD tubing.
15. Perforate 2 holes at 416'; then establish circulation out bradenhead; Plug #8 from 416' to surface with approximately 190 sxs cement, circulate cement to surface.
16. ND DOP and cut off wellhead; Install P&A marker; RD & MO. Restore location per BLM stipulations.