

WORKOVER REPORT
El Paso Natural Gas Products Company
Frontier No. 1-B (GD)

- 7-4-64 to 7-9-64** **A packer leakage test was run on this well and it was found that there was communication between the producing zones.**
- 8-11-64** **A temperature survey was run inside the Dakota Tubing String, while producing the Gallup side and an anomaly was detected at approximately 5900'.**
- 9-15-64 to 9-16-64** **B&R Service Company set an Otis Type "T" Tubing Stop in the Dakota tubing string at 5911'. An Otis Type "F" Packoff Anchor using 1.315" OD, 1.70#/ft., J-55, N U Vinson tubing as a spacer pipe was set from 5910' to 5876', another Otis Type "T" Tubing Stop was set at 5876' to completely isolate the area suspected of causing communication.**
- 9-28-64 to 10-6-64** **A Packer Leakage Test was run and it was found that no communication existed between the Gallup and Dakota Zones.**