

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

RECEIVED  
BLM

Sundry Notices and Reports on Wells

98 NOV 18 PM 12:54

1. Type of Well  
GAS

070 FARMINGTON, NM

5. Lease Number  
I-149-IND-8468  
6. If Indian, All. or  
Tribe Name  
**NAVAJO**  
7. Unit Agreement Name

2. Name of Operator

**BURLINGTON  
RESOURCES**

OIL &amp; GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

8. Well Name & Number  
Navajo B #6M  
9. API Well No.  
30-045-23638  
10. Field and Pool  
Mesaverde/Dakota  
11. County and State  
San Juan Co, NM

4. Location of Well, Footage, Sec., T, R, M

1190' FNL 790' FWL, Sec.19, T-27-N, R-8-W, NMMPM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

## Type of Submission

## Type of Action

<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input checked="" type="checkbox"/> Other - tubing repair	

13. Describe Proposed or Completed Operations

It is intended to repair the tubing on the subject well according to the attached procedure.

14. I hereby certify that the foregoing is true and correct.

Signed *Duane W. Spencer* (KLM1) Title Regulatory Administrator Date 11/12/98  
TLW

(This space for Federal Office use)

APPROVED BY *Duane W. Spencer* Title \_\_\_\_\_ Date DEC - 3 1998

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NAOCO

**Navajo B #6M**  
**Mesa Verde/Dakota Commingle**  
**1190' FNL and 790' FWL**  
**Unit D, Section 19, T27N, R08W**  
**Latitude / Longitude: 36° 33.8571' / 107° 43.6670'**  
**DPNO: 32086A/32086B**  
**Tubing Repair Procedure**

**Project Summary:** The Navajo B #6M was drilled in 1980. The well was commingled in 1996. A **piston is stuck in the tubing**. We propose to pull the tubing, remove the stuck plunger, check for fill and replace any worn or scaled tubing.

1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify BROG Regulatory (Peggy Bradfield 376-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary. **CAUTION: There is a plunger stuck in the tubing**. Set a plug in the tubing as deep as possible to prevent the plunger from traveling while pulling pipe.
3. The Mesa Verde/Dakota tubing is 2-1/16", J-55, set at 6623'. Release donut, pick up additional joints of tubing and tag bottom (record depth.) PBTB should be at +/- 6707'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If fill covers any perforations then TIH with 4-3/4" bit and a watermelon mill on 2-1/16" tubing to below perforations, cleaning out with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary. TOOH with tubing. **NOTE: When using air/mist, minimum mist rate is 12 bph.**
5. TIH with one joint of 2-1/16" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Run a broach on sandline to insure that the tubing is clear. Land tubing at approximately 6590'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.
6. Production operations will install the plunger lift.

Recommended:

*Kevin Midkiff* 10/22/98  
Operations Engineer

Approved:

*Bruce W. Boyer* 10-27-98  
Drilling Superintendent

Kevin Midkiff  
Office - 599-9807  
Pager - 564-1653