UNITED STAT	TES		
DEPARTMENT OF INTERIOR		5. Lease Designation and Serial No.	
BUREAU OF LAND MANAGEMENT		Operating Agreement	
SUNDRY NOTICES AND REPORTS ON WELLS		6. If Indian, Allottee or Tribe Name.	
(Do not use this form for proposals to drill or to		Navajo Tribe	
deepen or plug back to a different reservoir.		7. If Unit or CA, Agreement Designation.	
Use Form 3160-3 for such proposals.)		/	
1. Oil well [] Gas Well [X] Other []			
Gas Well		8. Well Name and No.	
2. Name of Operator		Navajo Nation 29 #2	
S.E.R.H., INC.		9. API Well No. 30-045-25103	
3. Address & Telephone No. (505) 334-2555 c/o A. R. Kendrick, Box 516, Aztec, NM 87410			
4. Location of Well (Footage & S.T.			
· · · · · · · · · · · · · · · · · · ·	660' FEL	Big Gap Organ Rock/Penn/Beautiful Mtn Miss 11. County or Parish, State	
H - 29 - T27N - R19W		San Juan, New Mexico	
		F NOTICE, REPORT, OR OTHER	
[•] Notice of Intent	[•] Abandonment		nge Plans
	[] Recompletion	• •	Construction
[] Subsequent Report	[] Plugging Back	[] Non-	-Routine Fracturing
	[] Casing Repair	[] Wate	er Shut-Off
[] Final Abandonment Notice	[] Altering Casing	[] Con	version to Injection
	[] Other	[] Disp	oose Water
Intend to plug and abandon according will be recovered from casing where cement is indicated.	gallon or more will be us m shows the anticipated n the well. Therefore, the	ed to separate the cement plug naximum recoverable casing cement plugs will be placed in	- it is doubtful that any
A small circulation pit will be	necessary on the well pa	ad.	
NOTE: This format is issued in lieu of 14. I hereby certify that the foregoing Signed Research		NOV 41992 OIL CON DIST 3	RECEIVED RECEIVED RECEIVED 8 FAN
			DDBUALD
Approved by	Title	ABRROVED	
Conditions of approval, if any:		NOV 02 1992	
	MACOD	· A	REA MANAGER

ABANDONMENT PROGRAM

S.E.R.H., INC. NAVAJO NATION 29 #2 H-29-T27N-R19W

Kill well. Install BOP.

Haul 1800' 2-3/8" tubing to location for additional work string.

Pull 3736' of 2-3/8" tubing to prove length and quality.

TIH w/bit to drill out fill from 3760' and retainer @ 3780'.

Attempt to set 50' cement plug on bridge plug @ 5450', if unable to tag Bridge Plug, set 50' cement plug on fill inside of 4-1/2" casing where cement exist outside of casing.

TOH and pick up bridge plug - set bridge plug @ 3540' and TOH w/tubing.

Cut and pull casing from 3400'.

Run tubing to 3540', set cement plug from bridge plug @ 3540' to 2860' to cover casing stub and DeChelly formation.

Pull tubing to 2650' and circulate. SDON.

TIH to tag plug @2860'.

Pull tubing to 1550' and spot 200' plug to 1350'.

Pull tubing to 115' and fill hole with cement.

Set Marker.

Rehabilitated location when feesible.

S.E.R.H., Inc.
NAYAJO NATION 29 #2
1980' FNL 660' FEL
H-29-T27N-R19W

Lease No. Operating Agreement API No. 30-045-25103 Elev: 5770' GR, 5783' KB

