

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPlicate
(Other instructions on reverse side)

Form approved:
Budget Bureau No. 1004-
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL

BLM # SF-077329

6. IF INDIAN ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

McKenzie Methane Corporation

3. ADDRESS OF OPERATOR

1625 Broadway, Suite 2580, Denver, Co. 80202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

900' FSL, 1190' FWL NE $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$

7. UNIT AGREEMENT NAME

M

8. FARM OR LEASE NAME

Angel Peak 13M

9. WELL NO.

#1

10. FIELD AND POOL, OR WILDCAT

Basin Fruitland Coal

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 13-T27N-R10W

12. COUNTY OR PARISH 13. STATE

San Juan

N.M.

14. PERMIT NO. 15. ELEVATIONS (Show whether OF, RT, GR, etc.)

API# 30-045-27618

GR 6139'

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐
FRACTURE TREAT ☐ MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐ ABANDON* ☐
REPAIR WELL ☐ CHANGE PLANS ☐
(Other) Well Status Update ☒

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐ REPAIRING WELL ☐
FRACTURE TREATMENT ☐ ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐ ABANDONMENT* ☐
(Other) ☐
(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROMISED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

SEE ATTACHED WELL HISTORY

RECEIVED
JUN 11 1990
OIL OIL DIV.
1990

18. I hereby certify that the foregoing is true and correct

SIGNED San Cade

TITLE Technician

DATE 5-24-90

(This space for Federal or State office use)

ACCEPTED FOR RECORD

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

MAY 30 1990

NMOCD

FARMINGTON RESOURCE AREA

BY

*See Instructions on Reverse Side

4-17-90 TD 2087', PBTD 2044'. MIRU Triple P Well Svc, NDWH & NUBOP. Tally, PU, RIH w/3-3/7" bit, scrpr & 2-3/8" tbg. DO to FC PT csg to 3000 psi. Roll hole w/fr wtr. POOH, SDON.

4-18-90 Rn GR/CCL/CBL fr PBTD to 1600'. TIH & spot 90 gals 7-1/2% HCL @ 2018'. TOH & perf lwr FLDC w/3-1/8" csg gun, 2 spf fr 1949-51', 1959-61', 1977-82', 1994-2018'. TIH w/spit tl, 6' spacing w/colr locator. Brk dwn perfs fr 1994-2018' in 4 stages w/462gals 15% HCL. Avg rate 1.5 BPM @ 350#, avg ISIP 180#. Brkdwn perf fr 1977-82' w/125gals 15% HCL @ .8 BPM & 780#, ISIP 40#. Brkdwn perf fr 1959-61' w/85gals 15% HCL @ .7 BPM & 780#, ISIP 50#. Brkdwn perfs fr 1949-51' w/85gals 15% HCL @ 1.3 BPM & 380#. ISIP 270#. TOOH, TIH w/tbg & SN on btm. Lnd tbg @ 1999'. NDBOP & NUWH. Unload well w/N2. SI csg & press up perfs to 300#. Op well to pit up tbg overnite.

4/19/90 CP 150#, well gassing sli. RIH to swb & found 100' fl. Swbd well, well gassing sli w/CP @ 100#. RDMOSU. Flwg well to clean up.

4/26/90 Rn static BHP svy to 1990'. SICP 150#. MIRU Triple P Well Svc #1. Blw dwn tbg, TP/CP 0#. RU swb, md 1 rn. Well dry. NDWH, NUBOP. POOH w/tbg. SDON.

Set RBP & begin upr zne compl.

4/27/90 PBTD 2044', TD 2087'. WO Wireline, TIH & set RBP @ 1940'. Dump 1 sk sand on RBP, load hole & PT to 2000 psi. TIH w/tbg & spot 150 gals. 7 1/2% HCL @ 1915'. POOH, perf upper coals w/3 1/3" gun, 2 spf from 1804-07, 1819-22, 1883-1901, 1904-15. TIH w/spit tool, clr locator & 6" spacing. Breakdowns w/15% HCL. Release spit tool & POOH. TIH w/SN on 2 3/8" tbg & land @ 1904'. NDBOP, NUWH. Kick well around w/ N2. Leave well open to pit. SDON.

5/18/90 PBTD 2044', TD 2087' well op to pit. MIRU Triple P #1. Rn static BHP svy on upr cls. Blw well dwn. NDWH NUBOP. Load hle & POOH w/tbg. Rih w/retrieving head, circ sd off RBP. Rel RBP & POOH w/tbg & RBP. RIH w/tbg & SN on btm. Tag PBTD, PU & lnd tbg @ 2003'. NDBOP & NUWH. Swb well dry & leave op to pit. RDMOSU.