



PXA Procedures  
Storey C LS #1

1. RIH and spot cement plug to 2915' with 50.921 cuft cement. RIH with perf gun and shoot squeeze holes at 2364', circulate cement to 2135' outside casing, pull up and spot cement plug from 2364' to 2135' inside casing. (estimate 125.263 cuft cement)
2. RIH with tbg and cement retainer, set retainer at 1200', squeeze thru casing leak at 1300' to 1685' with 130.666 cuft cement, be sure that cement outside casing is to 923'. Pull out of retainer and spot cement plug to 923'. (95.591 cuft cement.)
3. TOOH, circulate cement down casing and up bradenhead. (235-266)
4. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
5. Turn over to John Schwartz for reclamation.
6. Rehabilitate location according to BLM or State requirements.

Verble to P-A Stephen Mason 8/15/94 9:00 am  
to Carol Ann w/ Amoco.