Form 3160-5 (December 1989)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED Budget Bureau No. 1004-0135 Expires: September 30, 1990

5. Lease Designation and Serial No.

#### I-149-IND-8475

SUNDRY NOTICES A	SUNDRY NOTICES AND REPORTS ON WELLS	
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  Use "APPLICATION FOR PERMIT" for such proposals		6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE		7. If Unit or CA, Agreement Designation
1. Type of Well		8. Well Name and No.
OIL WELL OTHER  2. Name of Operator  Amoco Production Company Melissa Velasco-Price  3. Address and Telephone No.  P.O. Box 3092 Houston, TX 77253 (281) 366-2548  4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		Gallegos Canyon Unit 18
		9. API Well No.
		30-045-07338
		10. Field and Pool, or Exploratory Area
		Basin Fruitland Coal
		11. County or Parish, State
1650' FNL 900' FEL Sec. 21 T2	8N R12W Unit H	San Juan New Mexico
CHECK APPROPRIATE BOX(s	E) TO INDICATE NATURE OF NOTICE, REP	ORT, OR OTHER DATA
TYPE OF SUBMISSION TYPE OF ACTION		ION
Notice of Intent	Abandonment     ■	Change of Plans
Subsequent Report	Recompletion	New Construction
Subsequent Report	Plugging Back	Non-Routine Fracturing
Final Abandonment Notice	Casing Repair	Water Shut-Off
	☐ Altering Casing ☐ Other	Conversion to Injection
		e completion on Well Completion or
Amoco Production Company reques	t permission to plug and abandon the subject	well per attached work procedure.
14. I hereby certify that the foregoing it to and corr Signed	ect Company Co	Date05/22/00
(This space for Federal or State office use)		
Approved by	Title	Date 6/30 00
Conditions of approval, if any:		

**GCU 18** 

Originial Completion: 7/52 (PC) Recompleted: 11/93 (FC)

TD = 1,429' PBTD = 1,376'

Page 2 of 2

## Objective: PXA entire wellbore, including Pictured Cliffs and Fruitland Coal formations

- 1. Notify regulatory agencies (BLM, NMOCD, FIMO) 24 hours in advance of plugging activity. Contact BLM and indicate well is allotted (FIMO regulations effective April 1, 1997).
- 2. Check location for anchors. Install if necessary. Test anchors.
- 3. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 4. TIH and tag CIBP set at 1,376' in November, 1993. Spot cement plug from 1,376' to 1,354' to cover the Fruitland Coal. TOH, rig up wireline, TIH and perforate at 660'. Pump cement down casing and circulate cement to surface leaving casing full of cement.
- 5. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 6. Contact FMC and ship surface equipment to yard or other location per instructions.
- 7. Turn over to Buddy Shaw for reclamation.
- 8. Rehabilitate location according to BLM or State requirements.

### **GCU 18**

## H21 T28N-R12W, 1650' FNL, 900' FEL API 3004507338 I-149-IND-8475

#### Proposed PXA Wellbore Schematic

