

Krause WN Federal # 6E
P&A Pcedure

11. RU WL. RIH with casing gun and perforate 4 holes at 3,258' (Mesa Verde). Close blind rams and est inj into perfs.
12. RIH with cmt ret. and set at 3,158'. Squeeze cmt from 3,258' - 3,158' with 55 sx Cla "B" cement. Sting out of CR. Spot 8 sx cmt on CR. PUH to 3,050' and reverse out 2-3/8" tbg. POH.
13. RU WL. RIH with casing gun and perforate 4 holes at 2,630' (Chacra). Close blind rams and est inj into perfs.
14. RIH with CR and set at 2,530'. Squeeze cmt from 2,630' - 2,530' with 55 sx Class 'B' cement. Sting out of CR. Spot 8 sx cmt on CR. PUH and reverse out 2-3/8" tbg. POH and LD stinger for CR.
15. RIH open ended to 1,700'. Spot 30 sk Cl "B" plug from 1,700 - 1,300' across Pictured Cliffs and Fruitland formations.
16. Pull up hole to 800' (50' below base of surface casing). Spot Cl "B" plug from 800' - surface to cover base of surface casing, Ojo Alamo formation and to serve as surface plug. FOH with tbg.
17. ND BOP. RD MO PU. Cut off wellhead 3' below ground level or at base of cellar (whichever is deeper). Weld on steel plate with 1" valve on top. Install abandoned well marker. Fill cellar with suitable material as specified by authorized officer.


R. D. Keathley


R. A. Meize