#### UNITED STATES

# DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Sundry Notic	ces and Reports on Wells			
		5.	Lease Number	;
1. <b>Type of Well</b> GAS		6.	NM 03600 If Indian, A Tribe Name	All. or
		7.	Unit Agreeme	ent Name
2. Name of Operator  BURLINGTON  RESOURCES		, ,	San Juan 29-7 Unit	
		8.	Well Name &	
<ol> <li>Address &amp; Phone No. of Operator         PO Box 4289, Farmington, NM 87499 (505) 326-9700</li> <li>Location of Well, Footage, Sec., T, R, M         1480'FNL, 600'FEL, Sec. 10, T-29-N, R-7-W</li> </ol>		9.	San Juan 29-7 U #63 API Well No. 30-039-07558 Field and Pool Blanco MV	
		10.		
		11. County and Stat Rio Arriba Co.		
Final Abandonment  Describe Proposed or Completing intended to remove the	Altering Casing Co X Other -remove packer		o Injection	
the attached procedure and	wellbore diagram.	· - · - · · · · · · · · · · · · · · · ·		
	(D) (E (C (E) (V) JAN 2 9 19: (O (L) (C (O) (N), (D) (D) (ST), 3			
	DIST. 3	ш <sub>.</sub> (у		
I hereby certify that the Signed Machuel	foregoing is true and corre		Date 1/12/	98
(This space for Federal or State APPROVED BY S/Duane W. Speno CONDITION OF APPROVAL, if any:	Office use)  Off Title	Date _	JAN 27 1998	-

## San Juan 29-7 Unit #63

#### Packer Retrieval

General Procedure

Inspect location and install and/or test rig anchors. Comply with all BLM, NMOCD, Forestry, and MOI rules and regulations. BE SAFE.

\*\*\*All vendors/service companies on location will be responsible for protection of the environment. Any questions call Steve Campbell 326-9546.\*\*\*

Blow down tubing. Do not kill well. NU full lubricator & test to wellhead pressure. RU wireline and set tubing plug in 1.81" F-nipple @ 5561'. Tubing should be dead.

- MIRU. Hold Safety Meeting. Place fire and safety equipment at strategic locations. Obtain and record all wellhead pressures. NU relief line to flow back tank. ND WH, NU BOP. Test BOP to 3000 psi. Add 6' spacer spool to top of BOP.
- 2. PU tubing to release 4 1/2" Baker Model R-3 Packer. Lower tubing slightly to engage J-pin to J-slot (this process prevents packer resetting during trip). Refer to Baker specialist on deck.
- 3. TOOH w/ 136 jts 2 3/8" 4.7# J-55 EUE tbg, 1.87" Model L sliding sleeve, 1 jt jts 2 3/8" 4.7# J-55 EUE tbg, and pull 4 1/2" Baker Model R-3 Packer into the 6' spacer spool. Visually inspect, tally, and stand back.
- 4. Shut pipe rams and open 2" csg valves to prevent pressure buildup.
- 5. Unscrew stripping heading assembly and pull stripping rubber and packer above stripping head assembly.
- 6. Install tbg slips. Remove and LD packer and sliding sleeve.
- 7. Screw back onto tbg string in stripping head assembly w/ tbg joint wedged in stripping rubber.
- 8. Screw stripping rubber back onto the stripping head assembly.
- 9. Open pipe rams and continue to TOOH w/ 42 jts 2 3/8" 4.7# J-55 EUE tbg, 1.81" F-nipple, and 1 jt 2 3/8" 4.7# J-55 EUE tbg. Visually inspect, tally, and stand back. LD Packer and sliding sleeve. (179 jts total).
- 10. Rabbit and TIH w/ exp check, 1 jt 2 3/8" 4.7# J-55 EUE tbg, 1.81" F-nipple (set @ 5557'), 178 jts 2 3/8" 4.7# J-55 EUE tbg. Land tbg @ 5588'.

## San Juan 29-7 Unit #63

# Packer Retrieval General Procedure

Inspect location and install and/or test rig anchors. Comply with all BLM, NMOCD, Forestry, and MOI rules and regulations. BE SAFE.

\*\*\*All vendors/service companies on location will be responsible for protection of the environment. Any questions call Steve Campbell 326-9546.\*\*\*

12. ND BOP. NU WH. Pump off check. Swab well if necessary. Contact Ken Johnson (326-9819) in Production Operations for well tie-in. RDMO.

Recommended

Summer Engineer II

Approved:

Regional Team Leader

Approved:

Dkilling Superintendent

#### **SAN JUAN 29-7 UNIT 63**

#### LEWIS/BLANCO MESAVERDE

UNIT H, SEC 10, T29N, R7W, RIO ARRIBA, NM

