

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR  
Tenneco Oil Company E & P WRMD

3. ADDRESS OF OPERATOR  
P. O. Box 3249, Englewood, CO 80155

4. LOCATION OF WELL (Report location clearly and in accordance with State requirements.  
See also space 17. below )  
At surface  
1650' FSL, 1650' FWL

14. PERMIT NO

15. ELEVATIONS (Show whether FT., GR., ETC.)  
6310' GL

5. LEASE DESIGNATION AND SERIAL NO.  
SF-078502

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Vanderwart A LS

9. WELL NO.  
2

10. FIELD AND POOL, OR WILDCAT  
Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec. 11, T29N, R8W

12. COUNTY OR PARISH 13. STATE  
San Juan NM

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☒  
SHOOT OR ACIDIZE ☒  
REPAIR WELL ☒  
(Other)

PULL OR ALTER CASING ☒  
MULTIPLE COMPLETE ☐  
ABANDON\* ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐  
FRACTURE TREATMENT ☐  
SHOOTING OR ACIDIZING ☐  
(Other)

REPAIRING WELL ☐  
ALTERING CASING ☐  
ABANDONMENT\* ☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and other pertinent to this work.)

Tenneco requests permission to plug off, sidetrack, run casing, and recompleate the referenced well according to the attached detailed procedure.

RECEIVED  
SEP 26 1985  
OIL CON. DIV.  
DIST. 3

18. I hereby certify that the foregoing is true and correct

SIGNED

*John M. Kinn*

TITLE Sr. Regulatory Analyst

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

ch

\*See Instructions on Reverse Side

NMOCC

APPROVED  
DATE May 15, 1985

DATE SEP 24 1985  
*John M. Kinn*  
AREA MANAGER  
FARMINGTON RESOURCE AREA

RECOMMENDED REMEDIAL WORK

DATE 2-7-85

WI 50.000000

LEASE Vanderwart A LS WELL NO 2 TENNECO RI 42.250000

LOCATION 11K-29N-08W FIELD CO. San Juan STATE New Mex

TD DRILLED 5425' PBTD 5425' KB ELEV. COMP. DATE 2-11-53

I.P.: OIL WATER GAS 4640 HOURS DATE 3-11-53

COMPLETION METHOD Open Hole - S.N.G.

PRODUCTION METHOD Flowing up tbq

KB 10 FEET ABOVE GROUND

PAY ZONES

Name	Cliff House	Menefee	Pt.Lookout	Total
Top	4645	4813	5238	4645
Base	N/A	N/A	5425	5425
Net Pay				780
I.P.				4640 MCFD
Date of I.P.				3-11-53

CASING AND LINER RECORD

SIZE	WEIGHT	DEPTH	CEMENT	HOLE SIZE	DATE	REMARKS
9-5/8"	25.4#	173'	125	12-1/4"	1/53	Surface
7"	23#	4612'	300	8-3/4"	"	TOC @ 3000'
2-3/8"	4.7#	5371'				

CURRENT PROD. TEST: OIL WATER GAS 3 MMCF/MO HOURS  
REASON FOR REMEDIAL WORK Currently completed in open hole.

ECONOMIC SUMMARY

GROSS:

TOTAL COST \$221M  
OUT OF POCKET

NET:

TOTAL COST \$110.5M  
OUT OF POCKET

PAY OUT (TOTAL COST)  
PAY OUT (OUT OF POCKET)  
ESTIMATED PRODUCTION INCREASE

APPROVED:

Peter M. Mueller  
Production Engineer

PA Jgh

MV & PC OPEN HOLE

SIDETRACK WORKOVER PROCEDURES-A

4251-1

LEASE Vandewart A LS WELL NO. 2  
9-5/8 "OD, 25.4 LB, CSG.W/125 SX  
TOC @ surface  
7 "OD, 23 LB, CSG.W/300 SX  
TOC @ 3000'


DETAILED SIDETRACKING PROCEDURE:

1. Prepare location by blading and installing anchors, if necessary. Install blowdown lines and blow well.
2. MIRUSU. Kill tbg w/1% KCl water.
3. NDWH. NU 11" 3M csg spool w/2-1/16" 3M plug valve. NU 7-1/16" DSA. NU 6" 3000 psi BOPE. NU blowdown lines to BOP.
4. Kill annulus w/1% KCl water.
5. POOH laying down tubing. Visually inspect tbg on trip out.


NOTE: If tbg is stuck, do not pull over 40K# as tbg may be in very poor condition. RIH w/jet cutter and attempt first shot at least 100' below the 7" csg shoe.

6. RUWL and run GR-CCL log from 100' below 7" csg shoe to the Fruitland Coal top. RIH on wireline and set Baker cement retainer approx 200' above the 7" csg shoe. PU stinger, crossover, 2-7/8" drill pipe and TIH. Fill hole and PT to 1500 psi prior to stinging into retainer.
7. Sting into retainer and establish injection rate. Squeeze open hole w/300 sxs Class H w/1% CaCl<sub>2</sub> (sidetrack plug). Sting out, pick up 30', and reverse tbg clean. TOOH and LD stinger.  
NOTE: Have cement tested w/field water for pump time and 24 hour compressive strength prior to cementing.

8. RDMOSU.
9. MIRU Dwinell Bros. Rig #1. RU to drill w/water.
10. TIH w/6-1/4" J-1 bit, bit sub, 10 4-3/4" drill collars, and balance of drill pipe to TOC. Drill out cement retainer, and dress off open hole plug to 15' below the 7" csg shoe. Circulate hole clean and TOOH.  
NOTE: Caliper ALL tools, O.D. and I.D., before running in hole.
11. RU to drill w/gas. PU 6-1/4" J-33 bit, knuckle joint kick-off assembly, 4-3/4" drill collars and TIH. Blow hole dry w/N<sub>2</sub>. Take inclination (TOTCO) survey on wireline before drilling. Drill 15'-20' and take another TOTCO survey. When angle has built approx 7°, blow hole clean and POOH.
12. LD knuckle joint. TIH w/J-33 bit, 6-3/16" near bit reamer, and 4-3/4" drill collars. Drill Mesaverde section w/gas to approx 450' below the top of the Point Lookout. Take TOTCO surveys every 500' or less as required, recording all surveys in the daily log. At T.D., blow hole clean and TOOH for logs.

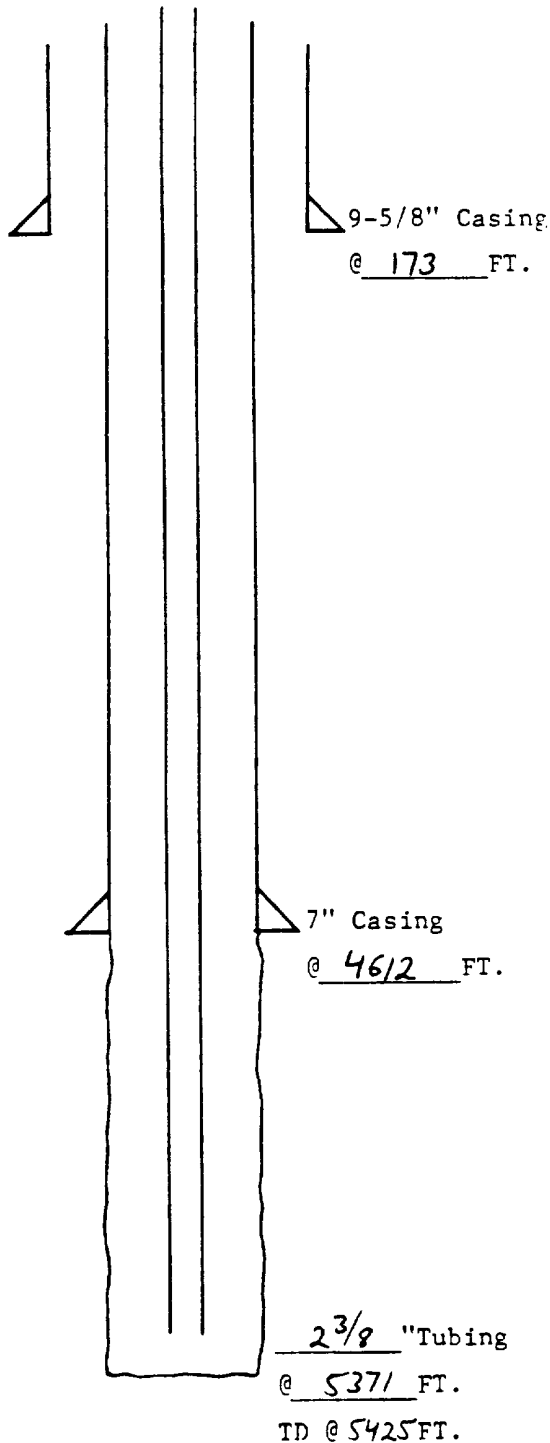

MESAVERDE SIDETRACK WORKOVER - B

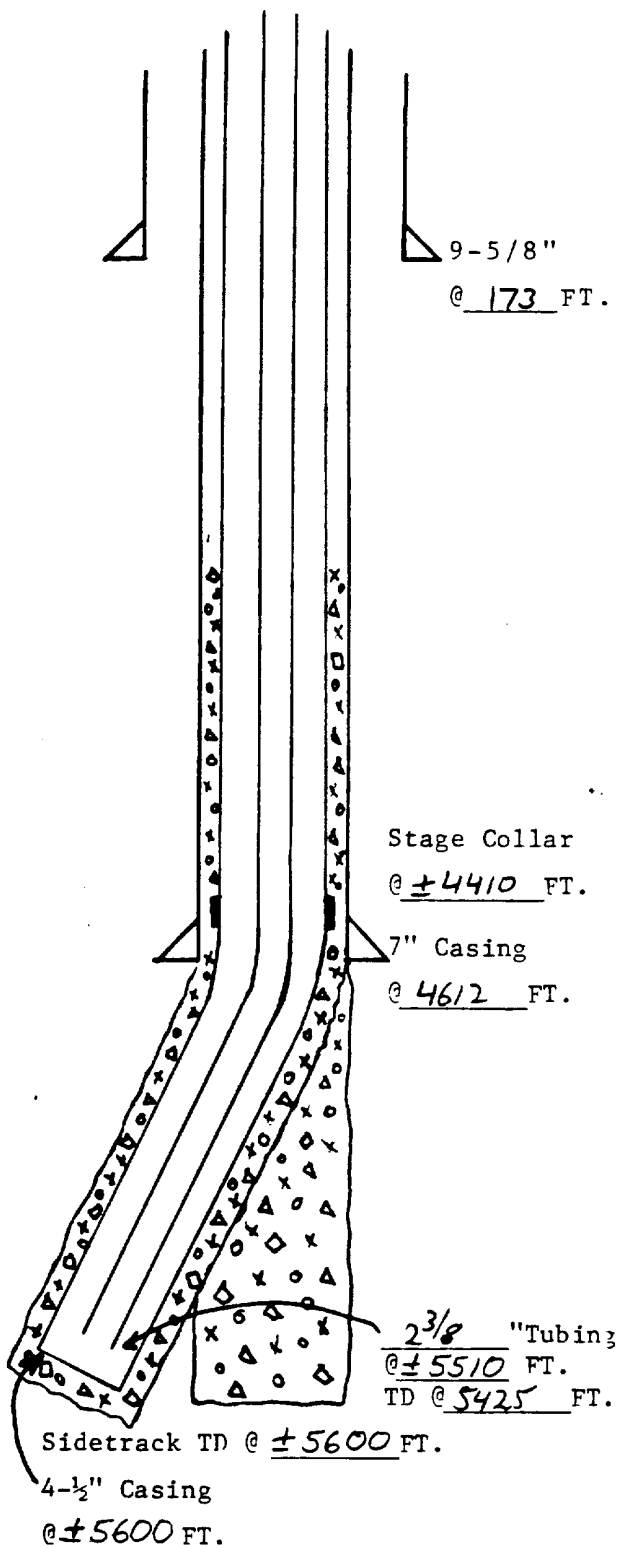

4251-2

LEASE Vandewart A LS WELL NO. 2  
 9-5/8" OD, 25.4 LB, CSG.W/125 SX  
 TOC @ surface  
 7" OD, 23 LB, CSG.W/300 SX  
 TOC @ 3000'


DETAILED SIDETRACKING PROCEDURE (CONTINUED):

13. RUWL and run GR-DIL and GR-CDL-Caliper over entire open hole. TIH for wiper trip, blow hole clean, POOH laying down, and RU to run csg.
14. Run 4-1/2" 10.5# K-55 STC csg as a full string as follows:
  - A) Conventional float shoe and shut off baffle one joint up.
  - B) One centralizer w/stop ring in the middle of the shoe joint and one centralizer on the collar above. Run one centralizer on every other collar in the open hole. Place one centralizer on the first collar below the wellhead (approx 15 centralizers total).
  - C) Run at least 1 short (flag) joint approx 200' off bottom.
  - D) Run stage collar tool @ 4410 ft. (approx 200' above 7" shoe).
  - E) Casing will be electronically inspected before arriving on location. Visually inspect body and end areas and drift to 4.052".
  - F) Thread lock all connections up to and including the float collar. Use API csg dope on all remaining connections. Recommended csg torque is 1460 ft-lbs.
15.
  - A) Precede 1st stage cement w/10 BBLS mud flush containing fluid loss additive.
  - B) Reciprocate csg w/20' strokes and cement first stage w/150\* sx Class B containing 6/10% fluid loss additive (D-60, Halad-9).
  - C) Drop shut-off plug and displace w/84 BBLS 1% KCl water. If plug does not bump, do not overdisplace.
  - D) Drop opening bomb. After allowing time for bomb to seat, pressure up csg to open stage tool.
  - E) Cement 2nd stage w/300 sx 65/35 POZ-mix containing 6% gel (12.4 ppg, 1.84 FT.<sup>3</sup>/SK, 9.9 gal/SK) & tail-in w/50 sx Class B containing 2% KCl.
  - F) Drop closing bomb and displace w/69 BBLS fresh water. If plug does not bump, do not overdisplace.  
 \*Final amount to be determined by caliper log + 10%.  
 NOTE: Have cement blends tested w/field water for pump time and 24 hour compressive strength prior to pumping. Use cementing company's csg hardware (float shoes, float collars, stage collars, etc.).
16. Set slips w/full csg weight. NDBOP and cut off 4-1/2" csg. NU tbg spool. PT wellhead to 3000 psi.
17. RDMO Dwinell Bros. #1.

*[Signature]*  
 Drilling Department

# MESAVERDE SIDETRACK

## COMPLETION DIAGRAM - C

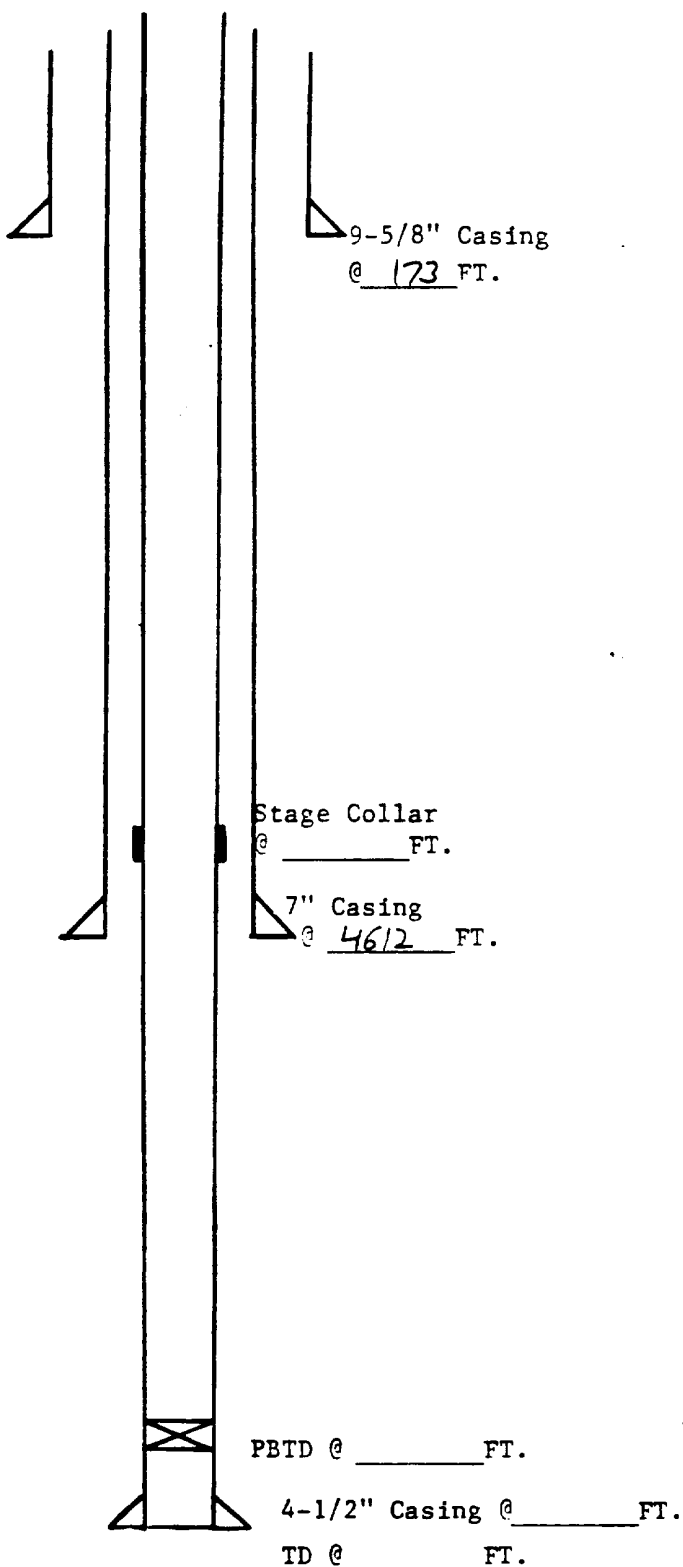

4251-3

LEASE Vandewart A LS WELL NO. 2  
3-5/8 "OD, 25.4 LB, CSG.W/125 SX  
 TOC @ surface  
7 "OD, 23 LB, CSG.W/300 SX  
 TOC @ 3000'

### DETAILED COMPLETION PROCEDURE:

18. MIRUSU. NU BOPE.
19. PU 3-7/8" bit, csg scraper, 2-3/8" 4.7# J-55 EUE 8rd tbg & tally in hole. Fill hole & PT csg to 3500 psi. Rev hole clean & displace w/1% KCl wtr.
20. Spot a sufficient quantity of 7-1/2% DI HCl to cover the perforated interval + 200'. POOH & LD bit & scraper.
21. RUWL. Run GR-CCL fr PBTD to 150' above the highest pay. Perf the Lower Mesaverde under lubricator as directed by the Geological Dept from the top interval down. Use 3-1/8" hollow carrier csg guns loaded 2 JSPF @ 120° phasing.
22. Acidize down csg w/20 gal per perf of 15% wgt'd HCl containing 600# NaCl/1000 gal & 1.5 1.1 SG RCN ball sealers per perforation. Displace at maximum rate w/MSP less than 3500 psi.
23. RIH w/junk basket on WL to knock off & recover ball slrs.
24. RU & frac Lower Mesaverde w/slickwater containing 1% KCl, 15#/1000 gal friction reducer & 2500#/ft 20/40 sand @ 1 BPM/perf; fluid/sand (design on following page). Flush to 10 BBLS shy of top perf & close blind rams ASAP.
25. RUWL & RIH w/Baker 4-1/2" RBP. Set approx 50' above top perf. Dump 2 sx frac sand on RBP, load csg w/1% KCl water, & PT RBP to 3500 psi.
26. TIH w/2-3/8" tbg to approx 10' above the RBP & spot a sufficient quantity of 7-1/2% DI HCl to cover the top perf + 200'. POOH.
27. RUWL. Perforate the Upper Mesaverde under lubricator as directed by the Geological Engineering Dept from the top interval down. Use 3-1/8" hollow carrier csg gun loaded w/2 JSPF @ 120° phasing.
28. Acidize down csg w/20 gal per perf of 15% wgt'd HCl containing 600# NaCl/1000 gal & 1.5 1.1 SG RCN ball sealers per perforation. Displace at max rate w/MSP less than 3500 psi.
29. RIH w/junk basket on wireline to knock off & recover ball sealers.
30. RU & frac Upper Mesaverde w/slickwater containing 1% KCl, 15#/1000 friction reducer, & 2500#/ft 20/40 sand @ 1 BPM/perf; fluid/sand design on following page. Flush to 10 BBLS shy of top perf.
31. RD frac head. PU retrieving head for 4-1/2" RBP & TIH on 2-3/8" tubing. CO to RBP w/foam. Latch on to RBP & POOH. LD RBP & retrieving head.

MESAVERDE SIDETRACK

COMPLETION DIAGRAM - C

4251-4

LEASE Vandewart A LS WELL NO. 2  
9-5/8 "OD, 25.4 LB, CSG.W/125 SX  
 TOC @ surface  
7 "OD, 23 LB, CSG.W/300 SX  
 TOC @ 3000'

DETAILED COMPLETION PROCEDURE (CONTINUED):

32. TIH w/2-3/8" production string as follows:  
 1 jt 2-3/8" tbg  
 1 1.781" ID SN w/expendable plug  
 Balance of 2-3/8" tbg
33. Tag fill & record amount. CO to PBTD w/N<sub>2</sub> foam. PU & set bottom of tbg within 20' of lowest perforation. Land tbg & NUWH.
34. Kick well around w/N<sub>2</sub> & FTCU.
35. RDMOSU. SWI for AOF.

MESAVERDE FRAC DESIGN:

1. 2500 #20/40 sand per ft. net pay.
2. 2 BPM per ft. net pay.
3. Fluid to contain 1% KCl, 15#/1000 gal friction reducer.
4. Schedule  
 30% pad  
 1 csg volume @ 1/2 ppg 20/40 sand  
 1 csg volume @ 1 ppg 20/40 sand  
 1 csg volume @ 1-1/2 ppg 20/40 sand  
 Remains @ 2 ppg 20/40 sd

*Peter M. Mueller*  
 Production Department

