

November 13, 1996

San Juan 30-5 Unit NP #6
SW, 19,30, 05

Well Notes:

- In 1953, the 8-5/8" 32# casing was inspected Condition 2.
- Well landed with 81 joints 1-1/4" tubing and 179 joints 1" tubing at 5676'.
- A 4-11-62, EPNG wellhead inventory notes: "gas leaking around outside of surface casing".
- In 1975, NWP proposed to sidetrack this well, moved on a 24 hour rig on 10-28-75.
- Found tubing parted, fished on 10-29 and 10-30; reported recovering both 1-1/4" and 1" tubing, quantities note specified.
- Ran Casing inspection log on 10-30-96 from 4705' to surface;
bad casing from: 100' to 370', 530' to 750', 1110' to 1230', 1400' to 2600';
bad hole at 2436' to 2444'.
- Obtained verbal permission to P&A well from BLM on 10-30-75.
- Rigged up BJ cementers on 10-31-⁷⁵~~96~~. They pumped 5 plugs from 0130 to 0400 hours; used 290 sxs Class B with 12% gel (yield 2.19 cf/sx). No perforating or tagging reported. Rig moved to next well at approximately noon on 10-31-75.