

WATER COMPLAINT ON SMITH RANCH

WATER WELL N-19-30N-05W
PHILLIPS PETR. "

S.J. 30-5 UT. 201 CIRC. CEMENT PRESS. ON BH

PHILLIPS PETR. K-19-30N-05W BEE KENNER #3 STRAT TEST 8 5/8 @ 198'
WELL WAS PLUGGED WITH 1200 SXS. OF CEMENT 4-23-51

NORTHWEST PIPELINE M-19-30N-05W S.J. 30-5 UT. NP #6 PLUGGED 10-31-75
DRILLED BY PHILLIPS 13 3/8 @ 364' 8 5/8 @ 5398' 300 SX T.D. 7976' P.B. T.D. 5700'
TEMP. SURVEY @ 2410'
P&A PROCEDURE 10-31-75

SPOTTED 60 SXS. 5412'-5012'
SPOTTED 50 SXS. 3051'-2751'
SPOTTED 60 SXS. 2560'-2160'
SPOTTED 50 SXS. 2000'-1700'
SPOTTED 70 SXS. CEMENT PLUG AT SURFACE

FORMATION TOPS
OJO ALAMO 2295'
KIRKLAND 2503'
PICTURED CLIFFS 2888'


WATER WELL HAS 2% GAS MEASURED FROM CSG.
CATHODIC WELL APPX. 40 YDS. NE OF WATER WELL HAS PRESS. ON 1" AND
MEASURES 60 % GAS.

201 HAS PRESS. ON THE B.H.

6 HAS GRASS AND SAGE GROWING AROUND THE P&A MARKER COULDN'T
CHECK FOR GAS DUE TO WATER AROUND THE WELLHEAD. THERE WERE NO
BUBBLES IN WATER.

3 LOCATED OLD LOCATION BUT THERE IS NO DRYHOLE MARKER PRESENT.
GRASS AND SAGE ARE ON THE LOCATION.

I CALLED RICHARD ALLRED WITH PHILLIPS AND ADVISED HIM OF THE
COMPLAINT AND OF OUR INVESTIGATION AND OUR FINDINGS. I ALSO POINTED
OUT THAT THE # 6 WELL HAD BEEN PLUGGED BY SPOTTING CEMENT INSIDE OF
THE CSG. LEAVING THE OJO OPEN BEHIND THE LONG STRING TO THE SURFACE
AND COULD BE THE CAUSE OF OUR PROBLEM. HE AGREED AND SAID HE WOULD
TALK TO ED HASELY AND GET BACK TO ME.

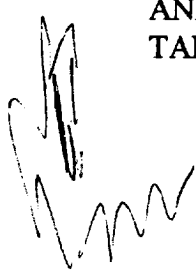

MR. ALLRED SAID THEY WOULD RE-ENTER THE WELL AND PLUG THE WELL PROPERLY IF I WOULD SEND PHILLIPS A LETTER STATING THAT THE # 6 WELL IS THE CAUSE OF THE PROBLEM. I TOLD HIM THAT MY PLANS WERE TO TEST AROUND THE WELLS WITH OUR PROBE AND TRY TO LOCATE THE BEN KENNEAR #3 WELL BY DIGGING IN A HOLE I FOUND ON THE LOCATION. RICHARD SUGGESTED MEETING US AND USING THERE METAL DETECTOR TO LOCATE THE SURFACE PIPE AND MEASURE PRESSURES ON THE WELLS IN QUESTION. I AGREED AND WE PLAN TO MEET IN THE LAST WEEK OF OCTOBER (WEATHER PERMITTING).

JOHNNY ROBINSON