

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Paramount Petroleum Corp. % NMOC

3. Address and Telephone No.

1000 Rio Br-205 Rd. Aztec, NM 87910 334-6178

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1880/S-1685/W Sec. 20, T.29N., R.13W.

5. Lease Designation and Serial No.

SF-079065

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

8 Aztec Torah DT

9. API Well No.

3004508011

10. Field and Pool, or Exploratory Area

Torah Gallup

11. County or Parish, State

San Juan, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See attached Report for P&A

RECEIVED
MAY 26 1998

OIL CON. DIV.
DIST. 3

14. I hereby certify that the foregoing is true and correct

Signed NMOC CONTRACT

Title

Date 5/21/98

(This space for Federal or State office use)

Approved by /s/ Duane W. Spencer

Title

Date 5/21/98

Conditions of approval, if any:

TRIPLE P WELL SERVICE, INC.

AZTEC TOTAH #8

RIG 6

START 3/25/98

END 3/31/98

1. Rig up Jetwest Wireline. Tubing cutter would not pass 2530'.
2. Run in hole with sandline and sinker bars, would not pass 2530'.
3. Pulled 30,000# on tubing. Tubing parted 104 joints @ 3276'.
4. Screw back into circulate hole clean. Run in with sandline. Tag up @ 3250'.
5. Rig up Jetwest, shoot tubing @ 3281'. Pull out 104 joints plus 5' of fish.
6. Run 4-1/2" scraper to 3276'.
7. Run in hole with 4-1/2 cement retainer – accidentally set @ 120'.
8. Run in hole with millbit and 4 drill collars. Drill out cement retainer. Run to bottom 104 joints.
9. Pickup cement retainer, tag fill @ 2646'.
10. Pull out of hole. Cement retainer set @ 2268'.
11. Cement below and above retainer with 130sx, 153cf.
12. Balance and displace 50sx, 59cf @ 1228'.
13. Tag plug @ 725'.
14. Shoot squeeze @ 250'. Circulate 230sx, 271cf to surface thru bradenhead. Pour cement.
15. Circulate 50sx, 59cf, thru bradenhead to surface.
16. Pump surface plug.
17. Cut off wellhead.
18. Install dryhole marker.