

Plugging procedure for Elvis Roberts Bergin #1

1. Clean out to 750'. *750' 600'*
2. ~~Perforate 750' and circ. cement to 600' inside and outside of pipe.~~ *740 - 640 IN & OUT*
3. Set cement plug from 350' to 450' inside outside of pipe.
4. Set cement plug 50'-150' ~~inside and outside pipe.~~
5. Set 10 sack surface plug and marker.
6. Level pits and clean location.

Presumed downhole equipment

8 5/8" casing @ 100' w/75 sx  
5 1/2" casing @ 1621' w/200 sx TOC @ 1264'  
PBD 1251' CIBP w/5 sx  
2 7/8" tubing @ 500' W/Lane Wells pkr  
1" tubing @ 500'

There is no cement behind pipe above 1264'. Well is producing through a casing failure @ 740".