

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30 039 07945
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Rosa Unit
8. Well No. 49
9. Pool name or Wildcat

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	2. Name of Operator Mitchell Energy Corporation
3. Address of Operator P.O. Box 4000, The Woodlands, Texas 77387-4000	4. Well Location Unit Letter <u>M</u> : <u>1190</u> Feet From The <u>south</u> Line and <u>1190</u> Feet From The <u>west</u> Line Section <u>27</u> Township <u>31N</u> Range <u>4W</u> NMPM <u>Rio Arriba</u> County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 6806' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

P&A complete 6-11-96. See attached report for detailed operations.

Surface reclamation operations were reviewed and approved by OCD representative, Johnny Robinson, 6-19-96.

**RECEIVED**  
JUN 26 1996

**OIL CON. DIV.**  
DIST. 3

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Cham King TITLE Engineering Technician DATE 6-20-96  
TYPE OR PRINT NAME Cham King (713) 377-6185  
TELEPHONE NO.

(This space for State Use)

APPROVED BY Johnny Robinson DEPUTY OIL & GAS INSPECTOR, DIST. #3 DATE JUN 26 1996  
CONDITIONS OF APPROVAL, IF ANY:

**FORM C-103 ATTACHMENT  
ROSA UNIT WELL NO. 49  
RIO ARriba COUNTY, NEW MEXICO**

12. 6-9-96 Kill well. ND tree. NU BOP's. POOH w/ tbg. RIH w/ cmt retainer and set @ 6249'. Squeeze Gallup perfs w/ 22 sx cmt. Pulled out of retainer and spotted 70 sx cmt plug. POOH. RIH w/ ELU and tag TOC @ 4733'. Cut 4-1/2" csg @ 3985'. Csg free. SDFN.
- 6-10-96 POOH w/ 4-1/2" csg laying down. RIH w/ tbg and spot 40 sx cmt plug. POOH.
- 6-11-96 RIH w/ ELU and tag TOC @ 3780'. Perforate @ 3570' and POOH. RIH w/ tbg to 3570'. Squeeze perfs and set balanced plug w/ 80 sx cmt. POOH. RIH w/ ELU and tag TOC @ 3220'. Pick up to 2200' and perforate. POOH. RIH w/ tbg to 2200'. Squeeze perfs and set balanced plug w/ 55 sx cmt. POOH. RIH w/ ELU and tag TOC @ 2038'. Pick up to 250' and perforate. Squeeze perfs and set balanced plug w/ 65 sx cmt. Top off w/ 35 sx cmt. Cut csg below GL. Weld cap and set dry hole marker. Back fill cellar. RD.