

UNITED STATES
DEPARTMENT OF INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICE AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION TO DRILL" for permit for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other <input type="checkbox"/>	5. Lease Designation and Serial No. SF-078771
2. Name of Operator WILLIAMS PRODUCTION COMPANY	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. PO BOX 3102 MS 37-2, TULSA, OK 74101 (918) 573-6254	7. If Unit or CA, Agreement Designation ROSA UNIT
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 2275' FNL & 1410' FEL, SW/4 NE/4, SEC 26 T31N R6W	8. Well Name and No. ROSA UNIT #211
	9. API Well No. 30-039-24430
	10. Field and Pool, or Exploratory Area BASIN FRUITLAND COAL
	11. County or Parish, State RIO ARRIBA, NM

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
Notice of Intent	Abandonment
X Subsequent Report	Recompletion
Final Abandonment	Plugging Back
	Casing Repair
	Altering Casing
	X Other <u>Repair tbg string</u>
	Change of Plans
	New Construction
	Non-Routine Fracturing
	Water Shut-Off
	Conversion to Injection
	Dispose Water
	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

05/20/00: RU rig & spot equip. Blow well down, NDWH, NUBOPs. Set 7" RBP @ 180'. ND BOP's & tbg head, NU new tbg head, pres test. Rel RBP, blow down. TOOH w/RBP. Hook-up flowline & put on line, SDFN

05/22/00: Travel to loc. Blow well down. POOH, LD 2-3/8" tbg. TIH w/ new tbg, tag PBTD @ 3240'. RIH w/ 101 new jts 2-7/8" prod tbg, land tbg in hanger @ 3217' kb w/ notch collar on bottom and "F" nipple one jt up @ 3184'. ND BOP's, NUWH. Pump out plug w/20 bbls prod wtr. Turn well to production, release rig

14. I hereby certify that the foregoing is true and correct

Signed

Tracy Ross
TRACY ROSS

Title Production Analyst

Date May 30, 2000

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

ACCEPTED FOR RECORD