

3-OCC  
1-F

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease <input checked="" type="checkbox"/> <b>Federal</b> <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>SF-080113</b>

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- 2. Name of Operator <b>Beta Development Co.</b> 3. Address of Operator <b>234 Petroleum Club Plaza, Farmington, New Mexico</b> 4. Location of Well UNIT LETTER <b>C</b> <b>990</b> FEET FROM THE <b>North</b> LINE AND <b>1750</b> FEET FROM THE <b>West</b> LINE, SECTION <b>26</b> TOWNSHIP <b>30 N</b> RANGE <b>11 W</b> NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) <b>5911' GR</b>	7. Unit Agreement Name 8. Farm or Lease Name <b>J.S. Hartman "A"</b> 9. Well No. <b>1</b> 10. Field and Pool, or Wildcat <b>Basin Dakota</b> 12. County <b>San Juan</b>
---	---

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Repair casing leaks w/packer and Kem-Pac chemicals, as follows:

Rig up workover rig, circulate out mud, sand and shale to T.D. Circulate until hole is clean. POH. Run Baker Model "D" production packer on wire line. Set packer just below Greenhorn section w/bump out plug to keep any water or Kem-Pac material from getting below packer. GIH w/tbg., Model "D" locator and tail pipe. Spot Kem-Pac above Model "D", set tail pipe down on bump out plug, run tail pipe through Model "D" and land locator seals in packer. Flange up well head, swab well in and re-acidize if necessary.



18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original signed by:  
JOHN T. HAMPTON  
SIGNED \_\_\_\_\_ TITLE **Manager** DATE **December 21, 1966**

APPROVED BY *Emery Clark* TITLE *Jay Rist III* DATE *12-23-66*  
CONDITIONS OF APPROVAL, IF ANY: