

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL AB NO.

30-045-09443

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

2. Name of Operator

THOMPSON ENGR. & PROD. CORP.

3. Address of Operator

7415 E. Main Farmington, N.M. 87402

8. Well No.

2

9. Pool name or Wildcat

Aztec PC (GAS)

4. Well Location

Unit Letter 0 : 840 Feet From The South Line and 1650 Feet From The East Line

Section 13 Township 30N Range 12W NMPM SJ County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Thompson Engineering plans to plug and abandon this well as per attached procedure.

RECEIVED
DEC 11 1995

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Paul C. Thompson

TITLE

Paul C. Thompson, President

DATE

12/7/95

TYPE OR PRINT NAME

TELEPHONE NO.

(This space for State Use)

APPROVED BY

Johnny Robinson

TITLE

DEPUTY OIL & GAS INSPECTOR, DIST. #3

DATE

DEC 11 1995

CONDITIONS OF APPROVAL, IF ANY:

Walsh Engineering and Production

Plug and Abandon Procedure for Thompson Engineering and Production Blancett #2

Location: SE/4 Sec 13 T30N R12W
San Juan County, NM

 
Date: Dec. 4, 1995

Field: Aztec Pictured Cliffs
Surface: Richard Blancett
Minerals: Fee

Elev: GL 5526'
PBSD 1895'

Procedure:

1. MOL and RU P&A rig. Hold safety meeting.
2. Blow well down and ND tubing head and NU BOP. Lay 2-3/8" flow lines to pit. Pressure test BOP.
3. Release donut and TOH with tubing.
4. Pick up 5" cement retainer on tubing and TIH. Set retainer at 1470'.
5. Pump 45 sx (53 cu. ft.) of cement below retainer, covering the open hole section and Fruitland top (100% excess in open hole and 50' excess in casing). Pull out of retainer and leave 3 sx of cement on top of retainer.
6. POH to 410' and spot plug #2 14 sx (16.5 cu.ft.) from 310' to 410'. 50' above and below Ojo Alamo top at 360' with 50' of excess.
7. TOH. Perforate 2 holes in 5" casing at 300'.
9. Circulate plug #3 138 sx. (163 cu.ft.) of cement down 5" and up 5" X 8-5/8" annulus through perfs at 300'.
10. ND BOP and cut off wellhead below surface casing. Install P&A marker. Rig down and release rig.
11. Clean location and restore as per surface owner requirements.



Paul C. Thompson, P.E.



Thompson Engineering and Production
 Blancett #2
 SE/4 13 30N 12W
 Plugged and Abandoned

