

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-045-09564
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name
8. Well No. Brimhall #1
9. Pool name or Wildcat Aztec PC
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER
2. Name of Operator E. H. Keyes, T.A.
3. Address of Operator P.O. Box 1387, Aztec, N.M. 87410
4. Well Location

Unit Letter A : 990 Feet From The North Line and 990 Feet From The East Line

Section 18 Township 30N Range 11W NMPM County SJ

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> OTHER: <u>OIL CON. DIV. DIST. 3</u> <input type="checkbox"/>
SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-10-92 Move rig on location, rig up, break wellhead off, TOH/W 96 joints of 1in. line pipe. TIH/W 62 joints of 2.375 tubing, tag bottom at 1955ft. pack off well-shut down, kill well with 2% KCL.

12-11-92 Tubing set at 1955ft. run 60sk. plug&displace hole. TOH with tubing wait 4hours. Tag plug @ 1475ft. with depthometer, TIH with tubing and packer set packer@ 300ft. pressure up to 500#-no leak, set packer@210ft pressure up 500# pin hole, set packer@ 180ft.-2bbl/m@230#-150ft-same.TOH set packer@30ft pumped 45sk. cement. Tear down equipment.

12-12-92 Top hole off with cement-4sk. rig down, erect dry hole marker, fill pit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Lonnie Cunningham TITLE Agent DATE 12-29-92
TYPE OR PRINT NAME Lonnie Cunningham TELEPHONE NO. 334-2780

(This space for State Use)

Original Signed by CHARLES GRULSON

APPROVED BY: _____ TITLE DEPUTY OIL & GAS INSPECTOR, DIST. #2 DATE DEC 29 1992

CONDITIONS OF APPROVAL, IF ANY: