UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

	7	ices and Reports on Wel	ASR 27 BILDE	17
1. T	ype of Well GAS	070	723736 6	Lease Number SF-077282 If Indian, All. or Tribe Name
2 N	ame of Operator	- E RI	NPR 2000	. Unit Agreement Name
2. N	BURLINGTON	FS CM	CONL DIV	
3. A	ddress & Phone No. of Operat	cor	BI SI I () () () () () () () () ()	. Well Name & Number Grenier A #3
	PO Box 4289, Farmington, NM	87499 (505) 326-9700	9	. API Well No. 30-045-13328
	ocation of Well, Footage, Se 510'FNL, 1620'FEL, Sec.34, 1			O. Field and Pool Blanco MV/Basin DK County and State San Juan Co, NM
	CHECK APPROPRIATE BOX TO INI			ER DATA
T	ype of Submission	Type of A		
	Notice of Intent	Abandonment	Change of	
	X Subsequent Report	Recompletion New Construction Plugging Back Non-Routine Fracturing Casing Repair Water Shut off		
	Final Abandonment	Casing Repair Altering Casing _X_ Other - Pay add		
		· · · · · · · · · · · · · · · · · · ·	7.1	·
13.	Describe Proposed or Compl	leted Operations		
13.	-	leted Operations		
13.	1-12-00 MIRU. SDON.	-	Model "D" cea	l accembly CDON
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical	ttempt to release 1 ½" tag tbg obstruction @ e point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To	1300'. Push d ger assembly me push plunger TH w/free points. TOOH w/128	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH.
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too	ttempt to release 1 ½" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, b' sand line in hole. To cutter, cut tbg @ 4138 pls. Fishing. SD for St	1300'. Push d ger assembly me push plunger TH w/free points. TOOH w/128 unday.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH.
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2	ttempt to release 1 ½" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 ols. Fishing. SD for St 2 3/8" tbg & fishing to	1300'. Push d ger assembly me push plunger TH w/free points. TOOH w/128 unday.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH.
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too	ttempt to release 1 ½" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 ols. Fishing. SD for St 2 3/8" tbg & fishing to	1300'. Push d ger assembly me push plunger TH w/free points. TOOH w/128 unday.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH.
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing too	ttempt to release 1 ½" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 ols. Fishing. SD for St 2 3/8" tbg & fishing to ols. Fishing. SDON.	1300'. Push diger assembly me push plunger PIH w/free points. TOOH w/128 anday. Dools. SDON.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing to	ttempt to release 1 %" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 pls. Fishing. SD for So 2 3/8" tbg & fishing to pls. Fishing. SDON. pols. TIH w/4 %" csg so cools. TOOH w/786' 1 %"	1300'. Push diger assembly push plunger TH w/free point. TOOH w/128 anday. Pools. SDON.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper
13.	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing to TIH w/fishing to	ttempt to release 1 ½" tag tbg obstruction @ ee point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 cls. Fishing. SD for So 2 3/8" tbg & fishing to cls. Fishing. SDON. pols. TIH w/4 ½" csg so cools. TOOH w/786' 1 ½" line. SD for Sunday. Continue	1300'. Push diger assembly push plunger TH w/free points. TOOH w/128 anday. Pools. SDON. Craper to 4100 tbg. TIH w/s	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper
14. Sign	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing too TIH w/fishing too TIH w/fishing too 1-19-00 Fishing. SDON. 1-21/22-00 Fishing sand I	tempt to release 1 ½" tag tbg obstruction @ te point to 6250'. Plur TOOH. TIH w/sand line, 'sand line in hole. To cutter, cut tbg @ 4138 tols. Fishing. SD for St 2 3/8" tbg & fishing to cols. Fishing. SDON. cols. TIH w/4 ½" csg se cols. TOOH w/786' 1 ½' line. SD for Sunday. Continue foregoing is true and	1300'. Push diger assembly a push plunger TH w/free points. TOOH w/128 anday. Dools. SDON. Traper to 4100 tbg. TIH w/s di on back correct.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper
14. Sign	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing too TIH w/fishing too TIH w/fishing too 4725'. SDON. 1-21/22-00 Fishing sand I	ttempt to release 1 %" tag tbg obstruction @ te point to 6250'. Plur TOOH. TIH w/sand line, o' sand line in hole. To cutter, cut tbg @ 4138 tols. Fishing. SD for St 2 3/8" tbg & fishing to ols. Fishing. SDON. Tools. TIH w/4 %" csg st cools. TOOH w/786' 1 %' line. SD for Sunday. Continue foregoing is true and Title Regulatory St e Office use)	1300'. Push diger assembly push plunger Pih w/free points. TOOH w/128 anday. Pools. SDON. Peraper to 4100 tbg. TIH w/s d on back correct.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper pear to top of fish @
14. Sign (Thi	1-12-00 MIRU. SDON. 1-13-00 ND WH. NU BOP. At 1-14-00 TIH w/sand line, TOOH. TIH w/fre not push down. TOOH. Left 2500 TIH w/chemical 1-15-00 TIH w/fishing too 1-17-00 Fishing. TOOH w/2 1-18-00 TIH w/fishing too 1-19-00 Fishing. SDON. 1-20-00 TOOH w/fishing too TIH w/fishing too TIH w/fishing too 1-19-00 Fishing. SDON. 1-21/22-00 Fishing sand I	tempt to release 1 ½" tag tbg obstruction @ te point to 6250'. Plur TOOH. TIH w/sand line, 'sand line in hole. To cutter, cut tbg @ 4138 tols. Fishing. SD for St 2 3/8" tbg & fishing to cols. Fishing. SDON. cols. TIH w/4 ½" csg se cols. TOOH w/786' 1 ½' line. SD for Sunday. Continue foregoing is true and	1300'. Push diger assembly a push plunger TH w/free points. TOOH w/128 anday. Dools. SDON. Traper to 4100 tbg. TIH w/s di on back correct.	own hole to 6649'. moved up hole, can assembly to 6649'. nt to 4180'. TOOH. jts 1 %" tbg. SDON. '. TOOH w/csg scraper pear to top of fish @

- 1-24-00 Fishing sand line. TOOH w/fishing tools. (Verbal approval to set cement above fish from Jim Lovato, BLM). TIH to top of sand line @ 4680' Pump 40 bbl wtr ahead. Pump 50 sx Class "B" neat cmt w/3% calcium chloride @ 4050-4680'. Displace w/11 bbl wtr. WOC. TOOH. SDON.
- 1-25-00 TIH, tag TOC @ 4174'. Load hole w/45 bbl wtr. TOOH. TIH, ran CBL @ 0-4170', TOC @ 3000'. TOOH. TIH w/cmt retainer, preset @ 3720'. Load hole w/wtr. Pressure up to 1000 psi, ran CBL @ 0-3700', TOC @ 3000'. (Verbal approval to squeeze @ 4174' from Steve Mason, BLM). TOOH. Establish injection into hole @ 4173'. TIH, pump 75 sx Class "B" neat cmt. Squeeze to 850 psi. TOOH. SDON.
- 1-26-00 (Verbal approval to plug and abandon from Jim Lovato, BLM). TOOH. ND BOP. NU WH. RD. Rig released.