

submitted in lieu of Form 3160-5

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

1. Type of Well  
GAS
2. Name of Operator  
**BURLINGTON**  
**RESOURCES** OIL & GAS COMPANY
3. Address & Phone No. of Operator  
PO Box 4289, Farmington, NM 87499 (505) 326-9700
4. Location of Well, Footage, Sec., T, R, M  
990' FNL, 1454' FWL, Sec. 12, T-30-N, R-10-W, NMPM
5. Lease Number  
NM-03562
6. If Indian, All. or  
Tribe Name
7. Unit Agreement Name
8. Well Name & Number  
Stickle #1
9. API Well No.  
30-045-20762
10. Field and Pool  
Blanco Pictured Cliffs
11. County and State  
San Juan Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

Type of Action

- |  |   |  |
|--|---|--|
| <input checked="" type="checkbox"/> Notice of Intent | <input type="checkbox"/> Abandonment                      | <input type="checkbox"/> Change of Plans         |
| <input type="checkbox"/> Subsequent Report           | <input type="checkbox"/> Recompletion                     | <input type="checkbox"/> New Construction        |
| <input type="checkbox"/> Final Abandonment           | <input type="checkbox"/> Plugging Back                    | <input type="checkbox"/> Non-Routine Fracturing  |
|  | <input checked="" type="checkbox"/> Casing Repair         | <input type="checkbox"/> Water Shut off          |
|  | <input type="checkbox"/> Altering Casing                  | <input type="checkbox"/> Conversion to Injection |
|  | <input checked="" type="checkbox"/> Other - Restimulation |  |

13. Describe Proposed or Completed Operations

It is intended to repair the casing and restimulate the subject well according to the attached procedure and wellbore diagram.

Please cancel the sundry intended to plug and abandon the subject well approved 5/19/99.

14. I hereby certify that the foregoing is true and correct.

Signed Nancy Olthmanns for Title Regulatory Administrator Date 9/29/99  
TRC

(This space for Federal or State Office use)

APPROVED BY Ann J. J. J. Title Acting Team Date 10/1/99  
CONDITION OF APPROVAL, if any: Land

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NMOCD

Stickle #1  
Pictured Cliffs Slimhole Restimulation Procedure  
C 12 30N 10W  
San Juan County, N.M.  
Latitude: 36 Deg, 49.86 Min  
Longitude: 107 Deg, 50.27 Min  
API # 300452076200

**Summary:**

The subject well is a 1971 Pictured Cliffs slimhole completion through 2 7/8" casing. The casing did not test when the initial attempt to restimulate this well was done. The casing leak will now be isolated and a free point will be run to determine if casing is free below the leak. If so, the casing will be backed off as deep as possible. New casing will be run and tied back in and a bond log will be run. If the BLM requires a squeeze job the procedure will be written at that time. The new casing will then be pressure tested to 3700 psi and the cased hole interval will be cleaned-out to PBTD at 3,329' using air-mist and 1-1/4" drillstring. The Pictured Cliffs will be restimulated with 56,909 gal of 70Q N<sub>2</sub> foamed 30# linear guar gel and 175,000# 20/40 mesh sand. The well will then be cleaned-up and returned to production. This well will be completed as a Type "B" well.

- Comply to all NMOCD, BLM, and BR regulations. Conduct daily safety meetings for all personnel on location. Notify BR regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping **any** cement job. If an unplanned cement job is required, **approval is required before the job can be pumped. If verbal approval is obtained, document the approval in Dims.** Allow adequate notice prior to the pump time for the Agency to witness the cementing operation.
- Inspect location and wellhead and install rig anchors prior to rig move.
- Construct blow pit.

**Casing Repair**

1. MOL, hold safety meeting, and RU completion rig. Insure all safety equipment is strategically located and functioning properly. NU relief lines to blow pit. ND wellhead and NU 7-1/16" 3M BOP, stripping head, and blooie line. Test BOP.
2. PU and TIH with a 2-7/8" RBP and 1-1/4" tubing. Set RBP above top perf (3,216'). Release from BP. Spot 10' of sand on BP. TOOH.
3. PU 1 jt. 2-7/8" tubing and screw into casing. MIRU wireline specialties. Freepoint 2-7/8" casing.
4. PU 2-7/8" packer. TIH with 2-7/8" packer on 1-1/4" tubing. Set packer above bridge plug and test to 3700 psi. Release packer, TOOH, and set packer at lowest 100% freepoint in casing. Pressure test casing to 3700 psi below and above packer. If casing leak is below packer, RDMO. If leak is above packer continue with step 5. Release packer and TOOH.
5. RIH with stringshot. Back off casing at lowest joint 100% free. RDMO wireline specialties.
6. Circulate hole clean. TOOH and lay down old 2-7/8" casing.
7. PU and TIH with new 2-7/8" casing. Screw in to existing casing.
8. Pressure test casing to 3700 psi for 15 minutes. (If casing can not be screwed into or pressure tested to 3700 psi on first attempt contact Drilling Superintendent and Production Engineer to discuss procedure to run a Bowen casing patch.)
9. TIH with 1-1/4" tubing. Clean out to top of RBP. Latch on to 2-7/8" RBP and TOOH. Lay down RBP. TIH. CO to PBTD. TOOH and lay down 1-1/4" tubing.
10. RDMO.

**RIGLESS PROCEDURE**

11. Install 2 7/8 In. 6.5 # N-80 EUE 8rd sub and 5000 psi frac valve. Lay flowback line to pit.
12. Set two (2) 400 bbl frac tank(s) on location and fill with 720 bbl 2% KCl water. Treat tank with biocide prior to filling. Heat gel tank to 60-70 °F in winter.

Stickle #1  
**Pictured Cliffs Slimhole Restimulation Procedure**  
**C 12 30N 10W**  
**San Juan County, N.M.**  
**Latitude: 36 Deg, 49.86 Min**  
**Longitude: 107 Deg, 50.27 Min**  
**API # 300452076200**

13. RU stimulation company to frac down 2 7/8" casing. Hold pre-job safety meeting with all personnel on location. Pressure test surface lines to 4700 psi for 15 minutes. Breakdown perforations by bullheading 200 gals 15% inhibited acid ahead of fracture stimulation. Acid will contain the following additives:

- 1 gal/M HAI-81M (corrosion inhibitor)
- 1 gal/M SSO-21M (surfactant)

Fracture stimulate in 1.0 to 4 ppg stages at 35 BPM constant downhole rate with 56,909 gal of 70Q N<sub>2</sub> foamed 30# linear guar gel and 175,000# 20/40 mesh Arizona sand. **Maintain a bottom hole frac gradient of 0.65 psi/ft throughout job.** When sand is in hopper and the concentration begins to drop, call flush. **Maintain previous stage's slurry and N<sub>2</sub> rates. Quick flush to 100 ft. above top perforation with +/- 345 fluid gals.** Maximum treating pressure is 3700 psi. Monitor bottomhole treating pressure, surface treating pressure, downhole rate, foam quality, and sand concentration with computer van. Treat per the following schedule:

<u>Stage</u>	<u>Foam Volume (gal)</u>	<u>Clean Gel Volume (gal)</u>	<u>Sand Volume (lbs)</u>	<u>Type</u>
Pad	3,100	930	0	
1 ppg	2,000	627	2,000	20/40 Az
2 ppg	3,000	982	6,000	20/40 Az
3 ppg	25,200	8,594	75,600	20/40 Az
4 ppg	22,850	8,105	91,400	20/40 Az
Flush	(759)	(345 @ 55% N <sub>2</sub> )	0	
<b>Totals</b>	<b>56,909</b>	<b>19,584</b>	<b>175,000</b>	

Treat frac fluid with the following additives per 1000 gallons:

- 30# WG-19 (Gelling agent pre-mixed in full tank)
- 2.0 gal SSO-21M (Non-ionic surfactant pre-mixed in full tank)
- 0.5# GBW-3 (Enzyme breaker mixed on fly)
- 3.0 gal AQF-2 (Foamer mixed on fly)
- 0.18# BE-6 (Bacteriacide pre-mixed in full tank)
- 0.25 gal BA-20 (pH buffer mixed on fly)

14. Shut well in after frac and record ISIP. Empty remaining fluid in frac tanks to pit and RD stimulation company. Install flowback line above frac valve. Wait for 30 minutes to 1 hour before commencing flowback. Open well to pit in accordance to **flowback schedule enclosed in procedure**. If choke plugs off, shut well in and remove obstruction from choke and return to flowback schedule. **Do not replace with next larger choke size until schedule dictates.** Continue cleaning well up until fluid returns are negligible. **Take pitot gauges when possible.**

15. ND flowback line, frac valve, and isolation tool. NU production valve with flow tee. NU flowback line.

#### **SWAB RIG CLEAN-UP**

16. MIRU Silver Star. PU and RIH with 2 1/4" sand bailer. CO to PBTD at 3,329'. Monitor gas and water returns. **Take pitot gauges when possible.**
17. Continue cleaning up after frac until sand returns are a trace and fluid recovery is less than 2 BPH. TOOH. **Take final pitot gauge.**
18. RD and release swabbing unit.

Approve: *Scott Dobson* 9/21/99  
Team Leader

Approve: *Phil Smith*  
Drilling Superintendent

VENDORS:

Wireline:	Wireline Specialties	327-7141
Fishing Tools:	Baker	327-3266
Stimulation:	Halliburton	325-3575
Cement:	Cementers Inc.	632-3683

Isolation Tool, Frac Valve, & Flowback Line:	Dean Lingo	330-0144
--	------------	----------

Scott Dobson	Office - 326-9813	Home - 564-3244	Pager - 326-8036
--------------	-------------------	-----------------	------------------

# Stickle #1

Section 12 C, T-30 -N R-10 -W  
San Juan, New Mexico

## Blanco Pictured Cliffs Field Wellbore Schematic

