

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963—O-685229

treated down casing with 30,000#sd and 30,000 gals. water. No break down. Initial treating pressure 400 psi increased to 1525 psi at end of treatment after dropping 5 rubber balls. Initial injection rate 10 BPM increasing to 46 BPM at end of treatment. 1-25-73 started blowing hole down with gas to clean up and drill bridge plugs. 1-30-73 drilled out bridge plug at 4610. Well making large volume of gas and Frac. water and sand. Drilled out bridge plug at 5114' and cleaned hole to 5304. Rand 1½" tubing and landed at 5241. 2-3-73 Flanged well head and shut well in for pressure build up to test.

